



This manual has been scanned by the
Vickers MG Collection & Research Association

www.vickersmg.org.uk

Please support the work of the Association.

Click on the image to donate through
PayPal:



Or regularly support us through
Patreon:



Or make a quick, single donation:



A not-for-profit company, limited by guarantee, registered in England, Company Registration Number 07855202

NOT TO BE PUBLISHED

The information given in this document is not to be communicated, either directly or indirectly, to the Press or to any person not holding an official position in His Majesty's Service.

56
G.S. Publications
598



Notified in
A.C.L.S.
22nd April,
1942

Small Arms Training
Volume I, Pamphlet No. 10
Range-finder No. 12
1942

**(This pamphlet supersedes the 1937 edition
and Supplement, No. 1, 1941)**

Crown Copyright Reserved

By Command of the Army Council,

**THE WAR OFFICE,
22nd April, 1942.**

J. G. Gifford

DISTRIBUTION

Infantry Battalions	Scale A+10
Reconnaissance Battalions	" A+10
Machine Gun Battalions	" B+10
Infantry Training Centres	" A+5
Reconnaissance Training Centres	" A+5
Machine Gun Training Centres	" A+10
Guards Training Battalions	" A+10
Holding Battalions	" A+10

CONTENTS

	PAGE
Definitions	1
SECTION	
1. Importance of range-taking	2
2. Description of the range-finder	3
3. Theory	7
4. Selection of range-takers	8
5. Training—General remarks	9
6. General description—Packing and unpacking—Care and cleaning—Setting up and focusing.	
Lesson 1. General description—Packing and unpacking	11
Lesson 2. Care and cleaning	12
Lesson 3. Setting up and focusing	12
7. Coincidence.	
Lesson 4. Making coincidence and reading scale	14
8. Adjustments.	
Lesson 5. Adjustment of halving	17
Lesson 6. Accuracy and coincidence adjustment	17
Lesson 7. Known range method of adjustment	20
Lesson 8. Adjustment on natural infinity	22
Lesson 9. Adjustment on artificial infinity	24
9. Accuracy charts	27
10. The range-taker's note book	29
11. Consistency.	
Lesson 10. Calculation of consistency	30

[Continued on page iii of cover]

DEFINITIONS

Mean observed range (M.O.R.) is the mean or average of a series of readings on the same object. It is found by dividing the total of the series by the number of readings.

Mean deviation (M.D.) is the difference between the *mean observed range* and the *true range* to the object. It is recorded as plus or minus to one place of decimals, according to whether the M.O.R. is above or below the true range.

r is the range in thousands of yards.

Accuracy figure (A.F.) is a measure of the accuracy with which a range has been taken. It is found by dividing the mean deviation by r^2 of the true range.

It is expressed in terms of r^2 and as plus or minus according to the M.D.

$$\text{Formula} \quad A.F. = \pm \frac{M.D.}{r^2 \text{ of T.R.}}$$

Consistency figure (C.F.) is a measure of the consistency or "size of the group" of a series of readings. It is found in the following way:—

Find the difference between the M.O.R. and each reading; these figures are the *residuals*.

Divide the total of the residuals by the number of readings this figure is the *mean residual*.

Divide the mean residual by r^2 of the M.O.R.; this gives the *consistency figure*. It is expressed in terms of r^2 .

$$C.F. = \frac{M.R.}{r^2 \text{ of M.O.R.}}$$

SECTION 1.—IMPORTANCE OF RANGE-TAKING

1. Machine guns cannot obtain fire effect at long ranges, neither can the safety of our own troops be assured when fire is over their heads unless the range is accurately known.

2. Ranges for machine gun purposes may be obtained either by range-finder or from a map of not less than 1/25,000; but, as on a map it is often difficult, or even impossible, to identify the exact positions of guns, target and own troops, the range-finder is likely to be the normal method used, except when all calculations are made from a map, as in map shooting.

3. The allowance made in machine gun fire control and safety rules to cover errors in range is 5 per cent. The maximum error which might be made by trained range-takers under service conditions is $2\frac{1}{2}$ per cent. per 1000 yards; thus the range obtained should be within 5 per cent. up to 2000 yards.

4. When used with a 3-inch mortar detachment, time and ammunition may be saved if ranging is begun at the true range and our own troops may be more closely supported.

SECTION 2.—DESCRIPTION OF THE RANGE-FINDER

1. The instrument is officially known as the Range-Finder No. 12, Marks III, III**, IV, IV**, V and VI. The Mark VI is the latest service instrument; it differs from earlier types in minor details. These are described in Appendix IX.

The range-finder consists of two principal parts—the outer or main tube with the external arrangements as shown in Plates I and II, and the inner frame, containing most of the internal arrangements. Further details of the internal arrangements will be found in the Handbook of the Range-finder No. 12, 1933.

2. In order that the delicate mechanism, required to measure very small angles, may be able to withstand rough usage in the field the mechanism is mounted in an inner frame, with no rigid connection between it and the outer tube of the range-finder. The range-finder is thus made sufficiently robust to be carried in its case on any form of mechanical transport without damage or loss of adjustment.

3. The names of the external parts of the range-finder are given in Plates I and II, and are described in this paragraph. The following information will also be useful:

Base length of instrument	80 cm. (approx. $\frac{7}{8}$ yard)
Weight of range-finder	10 lb. 6 oz.
Weight of wooden case	16 lb.
Weight of canvas cover	4 lb.
Weight of stand	3 lb. 6 oz.
Magnification of right eyepiece	...	about	14 diameters
Magnification of left eyepiece	...	„	3 „
Dimensions of field of view—			
Width of field of view	...	about	3 degrees
Height of upper field of view	...	„	$\frac{3}{4}$ „
Height of lower field of view	...	„	$1\frac{1}{2}$ „

See Plates I to IV.

Outer tube (1).—The body of the range-finder consists of a steel tube about 34 inches long and $2\frac{1}{2}$ inches in diameter. This tube is covered with canvas and painted service green. This canvas tends to minimize distortion due to local heating by the sun.

Sewn on the canvas are fairways for the leather straps of the web sling (2).

Carrier plate (3).—A carrier encircles the outer tube near the centre. It affords a means of attaching the range-finder to the stand, and is fitted with bearing rings, in which the range-finder can be rotated in such a manner that the line of sight is raised or lowered.

Eyepieces (4). At the centre of the tube are the two eyepieces, which are surrounded by a **Rubber Facepiece (5)**. They are inclined downwards at an angle of 60 degrees to the horizontal for the convenience of the range-taker. The right eyepiece is the one through which is seen the object to which the range is to be taken. It is focused by means of the **small focusing lever (6)**. A revolving ring is mounted in the cap of the eyepiece. This ring is fitted with two glasses, one of which is clear and the other coloured, while a segment of the ring is left solid to protect the eye-lens of the range-finder when the instrument is not in use. The ring can be turned by the action of the thumb on its milled edge, which projects through the under-side of the cap. The coloured glass, termed a "moderating glass," is of assistance when taking ranges in hazy or very bright weather.

The left eyepiece is the one through which the range scale is seen. As the lens in it gives but a slight magnification no focusing arrangement is required. The left eyepiece is fitted with a revolving ring with a clear window, through which the range scale is viewed.

Front range scale window (7).—Above the left eyepiece, in front of the facepiece, is the front range-scale window for illuminating the range scale. It has a hinged metal cover to protect it.

Handles (8).—Beneath the range-finder, to the right and left of the eyepieces, are two folding handles, by means of which the range-finder is rotated when fixed to the stand, or held when no stand is used.

Working head (9).—Near the right handle, underneath the tube, is the working head, by the rotation of which coincidence is made. Its position has been so arranged that it can conveniently be revolved by the thumb and forefinger of the right hand, whilst the remainder of the hand grips the handle.

Astigmatizer lever (10).—Near the left handle is the astigmatizer lever. When the lever is pushed up towards the main tube the astigmatizers are brought into action.

Tube ends (11).—The ends of the outer tube are formed of hollow castings, slightly larger in diameter than the remainder of the tube. Circular openings are cut in these castings, and

are fitted with glass windows. Metal tubes with short rayshades are brazed over the hollow castings, and two hinged covers are fitted to the left tube ends.

These covers protect the **coincidence and halving adjusting heads (18), (19)**. **Leather protecting caps (12)** are fitted over the rayshades, and are attached to the tube ends by leather thongs.

End caps (13) and locking piece (14).—End caps, made of gunmetal, screw on to the tube ends. Each is fitted with a rubber pad, enclosed in canvas, for the protection of the range-finder.

The right window (15).—This is a piece of parallel optical glass used to keep out dust and damp.

Coincidence adjusting prism (16).—The left window consists of a deflecting prism of small angle to provide a means for the correction of errors in coincidence adjustment. For this purpose it is mounted in a ring which can be rotated by the coincidence adjusting head. A fixed graduated scale is engraved above the window, with an index on the revolving mount, for facilitating the coincidence adjustment.

Coincidence adjusting head (18).—This is carried on the top of the left end casting. It consists of a bevel wheel which is protected by a hinged cover. The bevel wheel is connected to the left end window (or coincidence adjusting prism) in such a way that the latter revolves slowly when the bevel wheel is turned. Beneath the head is a spring clicker which prevents accidental rotation due to vibration when travelling.

Halving adjusting head (19).—This is carried on the lower side of the left end casting, and consists of a bevel wheel which is covered in a similar manner to the coincidence adjusting head. The halving head is geared with the left pentagonal prism in such a way that, when it is turned, the prism is rotated very slightly on its axis. It has a clicker similar to that of the coincidence adjusting head.

Stand, instrument, No. 14, Mark III.—The stand (20), shown on Plates I, II and V, consists of three telescopic legs hinged to a socket; the legs permit of adjustment of the stand for height. The socket is fitted with an extension tube which permits of adjustment of the instrument for height without disturbing the position of the stand, the tube being clamped at the desired height by means of a clamping screw.

A pivot, to which the carrier of the range-finder is attached, is supported in a bearing secured internally to the upper end of the extension tube, and permits of the range-finder being traversed in the horizontal plane.

Case, No. 12, range-finder, Mark IV.—The case (Plate III) for the range-finder is of wood, and is provided with internal fittings to hold the range-finder.

A metal **adjusting lath** (2) is secured to the inside of the lid of the case by means of four screws at the centre. Four end screws are screwed into the case through elongated slots in the lath, so as to allow for expansion of the metal.


These end screws should never be screwed tight home.

The lath has two white lines exactly 80 centimetres apart. These are used for testing the coincidence adjustment of the range-finder on artificial infinity (*see* Lesson 9).

A **supporting rod** (3) is fitted to the lid of the case to keep the lid in a vertical position whilst adjusting the range-finder by means of the lath. The supporting rod is held in position by a plunger, and is drawn within the case when not in use.

Cover, No. 12, range-finder, Mark IV.—The Mark IV cover (Plate IV) is of canvas web fitted with a web sling for carrying. It is well padded internally with felt, the pads being covered with canvas as a protection against moth. A hole is cut in each felt pad to receive a pocket, in which cleaning materials may be carried, and a bucket is sewn to the exterior of the cover to accommodate the Mark III stand. The cover is fastened by means of straps, tabs, and studs.

PLATE VI

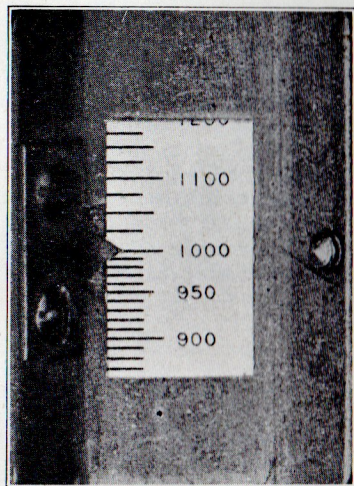

View of range scale as seen through left eyepiece

SECTION 3.—THEORY

1. The range-finder measures an angle. This is the angle subtended by the base length of the instrument at the object. As the base length is small compared with the range, the angle is very small, the largest angle measured being about 12 minutes, which is at the shortest range marked on the range scale—250 yards.

The instrument is so constructed that rays of light from an object enter the left window at right angles to the base of the instrument, and those entering the right window leave the object at an angle. When coincidence is made, the measurement of this angle gives the range, which will be indicated in yards on the range scale. Plate VI (page 7) shows the range scale reading 1000 yards.

2. In every coincidence there is a small error, and to obtain a reliable range it is necessary to take a series of readings and find the mean, when the errors in the individual coincidences will to a large extent average out. The mean of ten readings is used normally and, even for quick work, the mean of less than four readings must never be accepted as a range.

3. Any error in determining a coincidence will be an error in the angular measurement. The same angular error, as found in yards, increases as the square of the range. Thus the standard set, by which a range-taker's results are to be judged, must be in terms of the square of the range. The basis of calculation is r^2 , where r is the range in thousands of yards, to one decimal place.

4. Owing to variation of light and temperature errors in adjustment of the range-finder are unavoidable. To give the best results it must be adjusted (Sec. 8) under the same conditions as will exist when taking ranges. The trained range-taker should be able to judge the conditions and put a suitable setting on his instrument.

5. The range-finder gives different readings when coincidence is made in different parts of the field of view, and the centre of the field of view must therefore always be used.

SECTION 4.—SELECTION OF RANGE-TAKERS

1. Instructors will be trained on a range-finding course at Small Arms School, Netheravon or Ahmednagar. They should be trained to a fair standard of efficiency in their units before attending these courses; it is an advantage if they have at some time been trained range-takers.

2. A range-taker who has once been trained to a high standard, but has not kept in practice, can regain his former standard quickly, but while out of practice he cannot expect to obtain accurate ranges.

3. Men selected for training as range-takers should have the following qualifications :—

- i. Second class certificate of education.
- ii. Good and normal eyesight.

Although possessing these qualifications, some men will never become good range-takers; therefore the number of men in a class at the start should exceed the number of fully trained men required.

4. A man who wears glasses to correct short or long sight need not wear them when taking ranges, as the focusing lever can normally be adjusted to make the same correction as is made by his glasses; such men are therefore not unsuitable for training as range-takers. A man who wears glasses to correct astigmatism, however, should not be selected for training, as he must wear his glasses always to avoid eye-strain, and the glasses prevent him from placing his eye in the correct position in front of the eyepiece.

SECTION 5.—TRAINING—GENERAL REMARKS

1. System of training.—

i. Each stage in training should be introduced by one or more simple lectures by an officer, after which instruction should be continued by a N.C.O. During practical instruction each pair of men should work with one instrument, each man in turn assisting and checking the other.

ii. As a general principle the range-taker should be taught only what he should see in the field of view and what he has to do to produce the correct picture. The instructor should know in addition something of the working and theory of the instrument, details of which will be found in the Handbook of the Range-Finder, No. 12, 1933.

iii. A suggested syllabus for the training of new range-takers is given in Appendix I. This four weeks' syllabus should be sufficient to make the normal man a trained range-taker, although every opportunity for practice should be taken by the trained range-taker.

iv. It will be found that, if suitable men are chosen for training, they will be able to take accurate ranges after about three weeks' training, provided that it is uninterrupted. A fourth week will be required to teach them a range-taker's duties in the field.

v. Throughout training, the last half hour of each day's work should be devoted to the completion of records, a discussion of the day's results and a revision of previous work.

vi. Every man should be given a notebook when he begins training, and every reading taken by him will be noted in the book, with the exception of trial readings at the beginning of a series. A specimen page from a notebook is as follows :—

Date...	17th May.
Weather conditions	Bright and warm.
Setting used	R 2.4.
Object	Bush (2).

1*—(1784)

1725

1715

1700

1745

1695

1715

1725

1765

1755

1705

1700

1715

1720

True range 1762

M.O.R. 1722

M.D. -40

$$r^2 = 1.8 \times 1.8 = 3$$

$$\text{A.F.} = \frac{-40}{r^2} = \frac{-40}{3} = -13\frac{1}{3}$$

$$\text{M.O.R.} = 1722$$

2 Stages in training.—

- i. Introduction to the instrument and how to take ranges.
- ii. Practice in taking ranges to easy objects.
- iii. Taking ranges to more difficult objects.
- iv. Adjustment of the instrument to suit weather conditions.
- v. Use of cover and field duties.

SECTION 6.—GENERAL DESCRIPTION—PACKING AND UNPACKING—CARE AND CLEANING—SETTING UP AND FOCUSING

Instructor's Notes

Stores :—

The range-finding instrument in case.

Lesson 1.—General description—Packing and unpacking

1. General description.—The instructor will introduce the instrument, naming the parts, *see* Sec. 2.

2. Packing and unpacking.—

- i. *To transfer the instrument from case to cover.*—Should the lid of the case be very tight, the catch should be pressed and the lid given a slight jar upwards and to the rear with the palm of the hand.

The position of the instrument in the case should be memorized, and the difference between the lid and the bottom of the case noted.

The instrument is taken out of the case and laid in the cover, with the carrier inside the leather pad to prevent it from tearing holes in the cover.

The cover is closed, and all straps and buttons fastened, the stand being attached to the strap at the double end of the sling.

- ii. *Packing the instrument in the case.*—The carrier of the instrument must be as near the range scale window as possible, the handles towards the front of the case, and the right of the instrument on the right of the case. The case should be closed gently without force; should it fail to close, the following may be the cause :—

- (a) Instrument laid in the case the wrong way round.
- (b) Carrier plate misplaced or sling underneath.
- (c) Felt pads at end of the case rucked.
- (d) End windows not closed (Mark III).

Note.—The case should never be carried with the straps unfastened.

Lesson 2.—Care and cleaning

1. Although the range-finder is designed to withstand service conditions, it is necessary to guard against excessive jolting such as might occur if the instrument were dropped. Such treatment may cause loss of adjustment or even breakage. The range-finder should always be in its case when in transport, and in its cover when carried.

2. It is important that the range-finder be protected from damp. If used in the rain, it must be wiped dry before replacement in its case or cover, and must never be stored in a wet case or cover.

3. The windows and eyepieces must be kept clean, and should be covered except for actual range-taking. No oil or grease must be allowed to get on them, and they should never be touched by the hands. To clean the glass surfaces, use a clean piece of soft linen, silk or tissue; failing this, a clean piece of dry flannelette may be used. The glass must be rubbed firmly in one direction only, with a fresh piece of cloth for each stroke to avoid scratching the surface with grit already collected.

4. External metal surfaces should be cleaned with a dry cloth. Parts from which the paint or browning has worn may be wiped over with a slightly oiled rag before cleaning. A feather may be used for the crevices. Abrasives or metal polish must not be used.

5. The rubber facepiece should be removed periodically and washed in warm water. It must be thoroughly dried before replacement.

6. The instrument should not be exposed to gas if this can be avoided. When gas is present, it should be covered up, preferably in its case or cover, and afterwards the outside should be cleaned. If the outside of the instrument becomes contaminated, it should be washed carefully with petrol or paraffin, care being taken that no liquid penetrates the inside. Bleach paste must not be used. If it is thought that gas has penetrated to the inside of the instrument, it should be handed in to the ordnance workshops.

Lesson 3.—Setting up and focusing

1. The instrument will be removed from the case or cover, and the stand attached. It will then be mounted on its stand facing in the required direction, the windows and eyepieces will be uncovered, handles pulled down, and the astigmatizer lever pressed down.

2. The coincidence adjusting scale (Fig. 7, page 18) on the left window will be placed at the required setting by turning the coincidence adjusting head. The setting will be described as "Left (or right) so many divisions (and decimal fractions of a division)." The description "Left" or "Right" will be made when the scale is looked at the right way up, a scale which is actually at the bottom of the window being looked at over the top of the instrument, so that it appears as if it were at the top of the window.

3. The instrument must be mounted in such a way that the view to the front is unobstructed and the range-taker can assume a comfortable and steady position behind his instrument.

The range-taker's position should normally be lying, although sometimes it may be possible to mount the instrument on a vehicle or bank, etc. When so mounted the most suitable position will be adopted.

The instrument must be held by the handles, the body supported on the elbows, and the forehead rested lightly on the rubber facepiece.

When an anti-gas respirator is worn, the rubber facepiece of the instrument may have to be removed temporarily.

4. The instrument will be focused in the following way :—

The eyes will be rested for a short time on a distant object, and then placed to the facepiece. The focusing lever will be moved until the dividing line appears to be as thin and clear as possible against the sky. If this lever is moved correctly, all objects in the field of view will appear sharp and clear (except those at very short ranges), and, by accustoming the eye to a distant object before focusing, the focus will be such as to keep the eye at rest while taking ranges.

The instrument should never be directed at the sun. If this is done, both the instrument and the man's eyesight will suffer.

SECTION 7.—COINCIDENCE

Lesson 4.—Making coincidence and reading scale

Instructor's Notes

Lay stress on the importance of making coincidence in the centre of the field of view.

Check any tendency to slow and deliberate making of coincidences.

Insist that any coincidence that is "brought back" is cancelled; it breaks the sequence of coincidences from alternate sides.

Work out each man's adjustment for his day's work.

Ensure that all instruments are correct for halving.

1. The range-finder will be turned until it is square with the object, and then turned in its carrier plate until the object can be seen in the field of view. The object will always be kept in the centre of the field of view.

2. To make coincidence, the working head will be turned until the two images of the same object are cutting the dividing line at the same point on the images, in the centre of the field of view (Plates VII and VIII). There will be a considerable error in range if the actual part of the object on which coincidence is made is not exactly in the centre of the field of view (Figs. 1, 2 and 3).


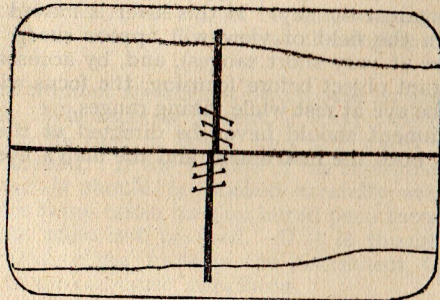



Fig. 1.—Incorrect coincidence.

Several coincidences must be made on the same object by bringing the images together from alternate sides, and it must be ensured that each coincidence is made without hesitation from the required side. The movement of the working head should be firm and steady, but not quick.

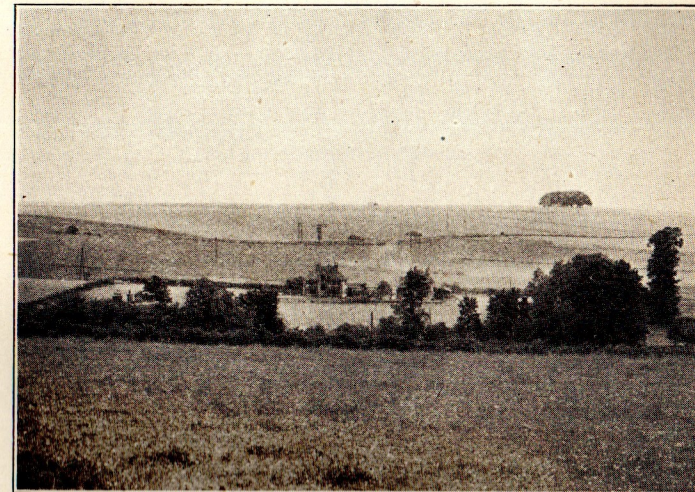

View of landscape in which object (T) lies.

PLATE VIII

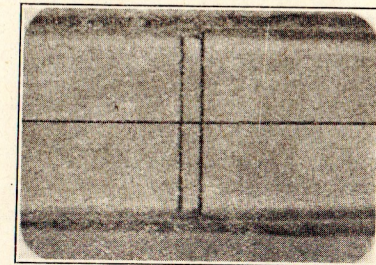

Coincidence of object T in landscape, Plate VII, as seen in the field of view.

Note.—The house below the object can be used as an aid to picking up the object in the field of view.

When coincidence is made on a straight line object, the range-finder should be so turned that the straight line cuts the dividing line at right angles. A straight line should be selected whenever possible.

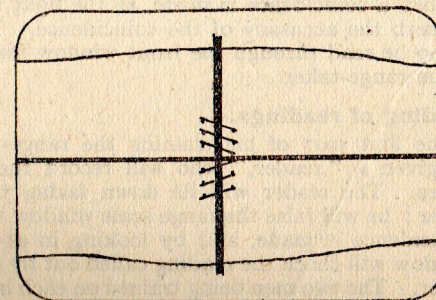


Fig. 2.—Correct coincidence.

3. Reading the scale (Plate VI).—A coincidence having been made, the range scale window should be opened and the range scale read through the left eyepiece. The divisions on the scale vary in size from 10 to 100 yards. The graduations on the scale are :—

From	250 yards to 1000 yards	...	10 yards.
"	1000 " " 1500 "	...	25 "
"	1500 " " 2000 "	...	50 "
"	2000 " " 5000 "	...	100 "

The infinity mark is indicated on the scale by means of a line and an asterisk, thus : " ————*." The range

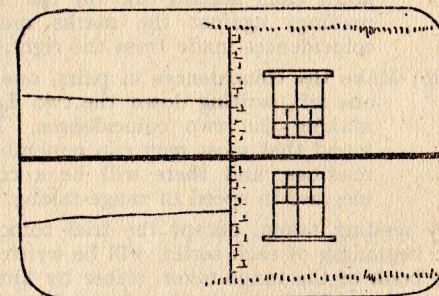


Fig. 3.—Correct coincidence. Note coincidence in centre of field of view. Wide object.

scale should be read as accurately as is permitted by the size of the divisions at the point in use. At short ranges it can be read to the nearest yard, and at longer ranges in multiples of 5 or 10 yards. The range scale window should be closed when a coincidence is made, as the light in the left eye will disturb the accuracy of the coincidence. The range scale can also be read through the front window for checking or testing the range-taker.

4. Recording of readings.—

- i. For the first part of his training the range-taker will be given a "reader," who will record the readings taken. The reader will lie down facing the range-taker; he will raise the range scale window when each coincidence is made, and by looking in at the front window will check the reading called out by the range-taker. The two men being trained on each instrument will act alternately as range-taker and reader, and the reader as well as the range-taker will ensure that coincidences are made directly from alternate sides.
- ii. Later in his training, the range-taker will be taught to write down his own readings as he will have to do in the field. It will be found difficult to remember from which side the last reading was taken, and practice will be necessary in some method of ensuring that readings are taken alternately from right and left. Also, it will be found that stopping to write down each reading will cause a considerable loss of time. The following two methods may be found helpful, the second being the quicker :—
 - (a) Before taking a series of, say, ten readings, mark each second line on the book. The readings against the marks must be for coincidences made from the right.
 - (b) Make the coincidences in pairs, one right and one left, writing down the two figures after making the two coincidences. It will be found that most men can remember the two readings, and there will be a considerable increase in speed of range-taking.
- iii. Every reading taken, except the trial coincidences at the beginning of each series, will be written down in the book of the range-taker, either by himself or by his reader. No estimate of a range will ever be given unless the readings have been written down, added up and divided by the number of readings.

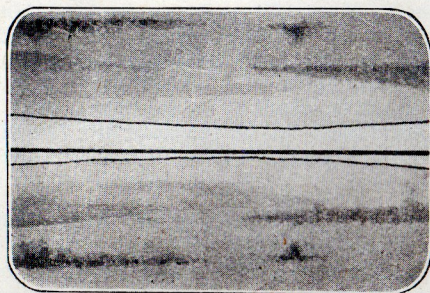


Fig. 4.—Halving incorrect. Top image too high

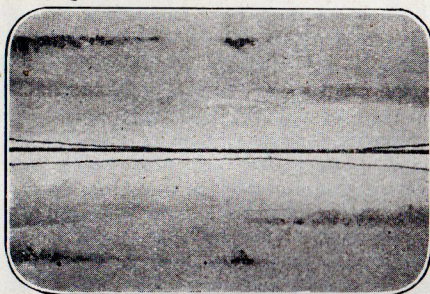


Fig. 5.—Halving incorrect. Top image too low.

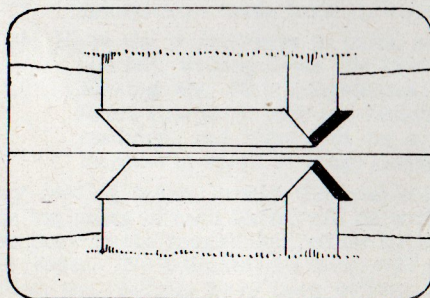


Fig. 6.—Halving correct.

SECTION 8.—ADJUSTMENTS

Lesson 5.—Adjustment of halving

(Figs. 4, 5 and 6)

Instructor's Notes

Begin the lesson indoors with diagrams of correct and incorrect halving and method of adjusting.

Outdoors, practise with straight-lined objects and compare results with flat-topped objects and crests.

The clicking system in the halving adjustment may not permit of an exact halving. Any man's halving may be very slightly different from the instructor's.

It will sometimes be found that the same points of each image do not touch the dividing line together, and a coincidence cannot be made. By turning the halving adjusting head, however, the upper image can be made to move up and down in the field of view and this error corrected.

To correct the halving :—

- (a) Look through the instrument at the selected object and bring the bottom image near to, and parallel to, the dividing line, *i.e.* leaving a thin sky space between it and the line.
- (b) Turn the adjusting head until the top image shows the same amount of space between it and the dividing line as the bottom image. By turning the adjusting head clockwise, the top image is raised and, counter-clockwise, lowered.

The halving is most easily checked and adjusted on a flat-topped object or a crest, and this checking must be done whenever the instrument is set up for taking ranges. If the halving is not in adjustment there will be considerable errors in the ranges taken, particularly in ranges to curves or irregular objects.

Lesson 6.—Accuracy and coincidence adjustment

A. Accuracy

1. The accuracy of a range depends upon the instrument being in adjustment. The instrument will be thrown out of adjustment by various factors :—

- (a) The weather.—Heat and cold affects the instrument, so that although it may have been adjusted one day, it may be found to be out of adjustment the next.

(b) Visibility.—This affects the range-taker, and makes it more difficult for him to make coincidence; therefore his series of readings will be less reliable.

(c) The man.—A range-taker will not be so accurate in his work if he is unfit, tired, uncomfortable or nervous.

Therefore it will be necessary to test the adjustment whenever possible, whether at home or on active service.

2. This can be done in two ways, by means of a known or true range, or by natural or artificial infinity. The accuracy of a series will be calculated, and if this is more than $5r^2$, when the consistency figure (lesson 10) is normal, a correction can be made to the C.A.S. (lesson 6) which will put the instrument into adjustment.

3. The accuracy figure.—(A.F.) is found by the formula—

$A.F. = \frac{M.D.}{r^2 \text{ of T.R.}}$ where M.D. is. the mean deviation and T.R. the true range.

Example:—

2356 T.R. 2382 r^2 of T.R. $= 2.4^2$
2365 M.O.R. 2360 $= 5.8$
2370

2355 M.D. -22
2360
2355
2344

2365 $\therefore A.F. = \frac{-22}{5.8}$

2375
2360

10) $\overline{23605} = -3.8$

M.O.R. 2360 $= -4r^2$

Infinity. $\begin{array}{cc} + & - \\ 1.4 & .7 \\ .8 & .5 \\ 1.2 & .2 \\ .4 & .9 \end{array}$ In this case the T.R. is zero, therefore the M.D. is $+ .2$ div. (the same as the M.O.R.).
1 division on the infinity scale represents $10r^2$.

$\therefore A.F. = + .2 \times 10$

4.4 2.3

2.3

$= + 2r^2$

10) $\overline{2.1}$

M.O.R. $+ .2$ div.

B. Coincidence adjustment

Instructor's Notes

The range-taker will be taught to work out his mean deviation and accuracy figure for each series taken on a known range during the day. The range-taking calculator or the table in Appendix V may be used normally, but each man must be able to divide his mean deviation by r^2 , in case he is without the table or calculator in the field.

The range-taker will then be taught to work out his mean accuracy figure for the day, and to calculate from this the new setting to be put on the coincidence adjusting scale.

The instructor will check the men's results by inspection, and by the range-taking calculator.

If some men in the class cannot make the calculation after a simple explanation and demonstration, they should be assisted with their calculations of each day's work until they can do so.

1. Owing to differences in eyesight, each man requires his own personal adjustment on any instrument, and owing to differences in instruments, he will require a different adjustment on each instrument that he uses.

In addition, a man will require to vary slightly the adjustment which he uses on each instrument, according to the weather conditions.

2. Turning the coincidence adjusting head alters the reading on the coincidence adjusting scale (Fig. 7), and also moves the upper image along the dividing line. Movement of the

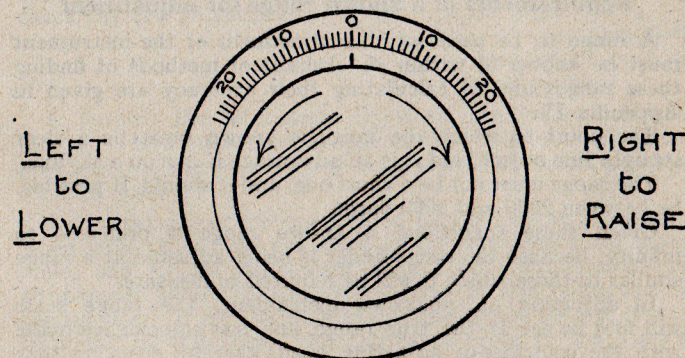


Fig. 7.—Coincidence adjusting scale.

coincidence adjusting scale has the effect of altering the mean observed range, so that the range-finder can be adjusted to suit each individual man.

An alteration of the coincidence adjusting scale by one division will make about $20r^2$ difference in the mean observed range, so that to produce an alteration of, say, $24r^2$ it is necessary to move the scale by $\frac{24}{20} = 1.2$ divisions.

To raise the mean observed range, the window is turned to the right, and to lower it, to the left. In recording the present reading on the scale it is necessary to describe the setting when the scale is looked at the right way up; with a scale on the bottom of the window the range-taker would look over the top of his instrument.

Lesson 7.—Known range method of adjustment

Instructor's Notes

Explain that either an unknown instrument, or their own instrument, can be adjusted accurately for the conditions of the day, if a known range is available.

Ensure that the known range fulfils the requirements, and that the instruments are placed on the actual point from which the range has been measured, or within 12 yards on a line at a measured right angle to the range.

Requirements of a known range for adjustment

A range to be used for the adjustment of the instrument must be known to within r^2 . Details of methods of finding these ranges and of calculating their accuracy are given in Appendix IV.

The point to which the range is known must be a clear straight line object, and it is an advantage if it is on a skyline.

The range must not be a short one, and it should, if possible, be between 2000 and 3000 yards.

Given these conditions, a known range is preferred to infinity, because the range-finder is being adjusted at a range similar to those which it will be required to measure.

In adjusting an unknown instrument, the range scale will first be set at the true range, and one coincidence made with the coincidence adjusting head, thereby ensuring that the ranges in the initial series will not differ widely from the true range.

Procedure.—The method of adjustment is as follows :—

Method

Example

1. *Test.*

Take a series of ten readings and work out the accuracy figure. If this is $5r^2$ of the true range, or less, the instrument is in adjustment. If this exceeds $5r^2$ of the true range, the instrument requires adjustment.

T.R.	2147 yds.
M.O.R.	2073 "
M.D.	minus 74 "
	or minus $16r^2$
∴ Instrument requires adjusting.	

2. *Adjust.*

If the accuracy figure is more than $5r^2$ of the true range, adjust by turning the coincidence adjusting head to compensate the error (*see* Lesson 6, para. 2, page 18).

$20r^2 = 1$ division.
$1r^2 = \frac{1}{20}$ division.
∴ $-16r^2 = R \frac{16}{20}$
$= R 0.8$ division.

The coincidence adjusting head must therefore be turned to the right 0.8 division from previous setting.

If it had been at	It would be moved to
R. 3.4	R. 4.2
L. 2.6	L. 1.8

3. *Check.*

Take a further series of ten readings and work out the accuracy figure to check the new adjustment.

T.R.	2147 yds.
M.O.R.	2163 "
M.D.	plus 16 "
	or plus $3\frac{1}{2}r^2$
∴ Instrument is now in adjustment.	

4. Turning the coincidence adjusting head may alter the halving, which must therefore be checked and adjusted whenever the coincidence adjusting head is turned, before another series is taken.

5. A difference of $20r^2$ per division may not apply accurately when large alterations are made on the coincidence adjusting scale, and so the instrument should be approximately in adjustment before the procedure given in this paragraph is carried out. If an approximate setting is not known, it can be found in this way: Set the range scale to the known range, and make one coincidence with the coincidence adjusting head.

6. Towards the end of his training, and in the field, the range-taker will be taught to work out his consistency (Sec. 11) as a guide to the reliability of the adjustment.

Lesson 8.—Adjustment on natural infinity

Instructor's Notes

Adjustment on moon and stars will be practised as convenient, beginning with the moon by day, if possible.

1. In the case of objects which are very far distant, such as the moon and stars, the range-finder records the range as infinity. Readings on the lath also give infinity. As infinity is marked on the range scale, the instrument can be adjusted on infinity in the same way as on a known range (see Lesson 7—Procedure).

The range-finder must never be directed towards the sun, or both the instrument and the man's eyesight will suffer.

2. Three divisions are marked above, and three below, the infinity mark on the range scale. Readings are noted as plus or minus from the infinity mark, and the mean calculated by dividing the difference of the pluses and minuses by 10. This gives the M.O.R. in divisions, and, as each division is $10r^2$, the accuracy figure is ten times the M.O.R.

3. The moon.—When the moon can be seen by day, it is a very good object for adjustment, because, in addition to the advantage of having daylight to work by, the range-finder is much nearer to the temperature at which it will normally be used.

In making coincidence on the moon, it is essential that halving be correctly adjusted, because on the curved edge an error in halving will make a considerable error in range; also particular attention must be paid to halving, because it is unlikely that an error will be noticed when there is nothing in the field of view but the moon itself. Halving can be adjusted on the top edge of the moon. Coincidence must

	plus	minus	Example
			0.8
	0.6		0.4
			1.0
	0.2		M.O.R. — 0.16
	0.8		
	0		M.D. — 0.16
		0.2	
	0		Accuracy
		0.8	figure—1.6r ²
	1.6	—3.2	
		1.6	
	10)	—1.6	
		—0.16	

be made on the clear outside edge of the moon, and not on the indefinite edge of a moon that is not quite full (Figs. 8 and 9). If necessary, the range-finder will be tilted so that a portion of the clear edge is at right angles to the dividing line.

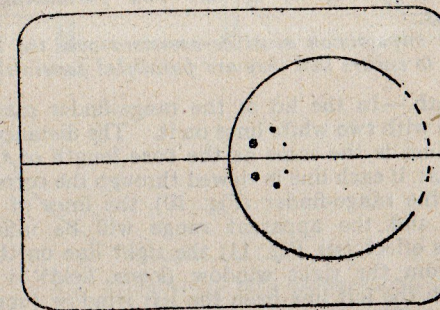


Fig. 8.—Correct coincidence on full moon. Note coincidence in centre of field of view.

4. A star.—In adjusting on a star, the astigmatizers must be used. Raising the astigmatizer lever causes both images of the star to become vertical lines, and coincidence is made much easier.

Adjustment must not be made on a star unless the astigmatizers have passed the test laid down in Appendix II; otherwise they may not be accurate, and there will be an error in adjustment.

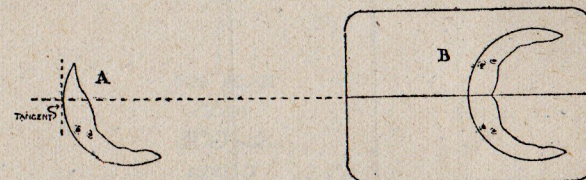


Fig. 9.—B showing correct coincidence on quarter moon. Note coincidence made with instrument horizontal, and dividing line at right angles to tangent shown dotted in A. A is the moon as seen with the naked eye. B is the same moon seen through the instrument.

Adjustment on the moon is preferred to adjustment on a star, because, even if the astigmatizers have passed the test, there may still be a small error in them.

Lesson 9.—Adjustment on artificial infinity

Instructor's Notes

Practise setting up of lath and paralleling at short distances.

Close supervision must be exercised over the laying out of laths to ensure that they are paralleled accurately.

1. The lath.—In the lid of the range-finder case there is a metal lath with two white lines on it. The distance between these two lines is the same as the base length of the range-finder, so that, if each line is viewed through the corresponding window of the range-finder (Fig. 10), the lines of sight will be parallel and the apparent range will be infinity. To produce this effect (see Fig. 11) the right line on the lath in the view from the right window (lower field) is made to coincide with the left line from the left window (upper field). The range will appear to be infinity.

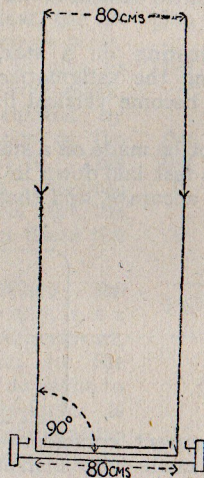


Fig. 10.—Diagram showing how artificial infinity is created.

2. The case must be set up at least 300 yards from the range-finder, so that any small error in the length of the lath will have little effect. The greater the distance the better, but visibility will not normally allow the case to be more than 500 yards

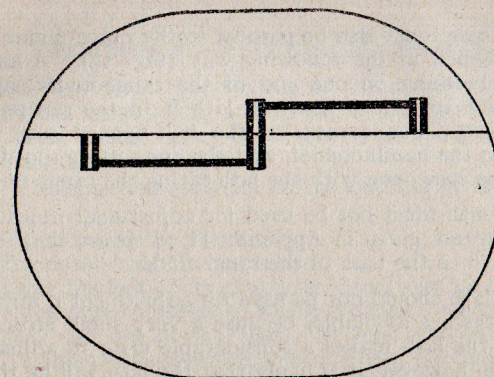


Fig. 11.—Size of lath exaggerated.

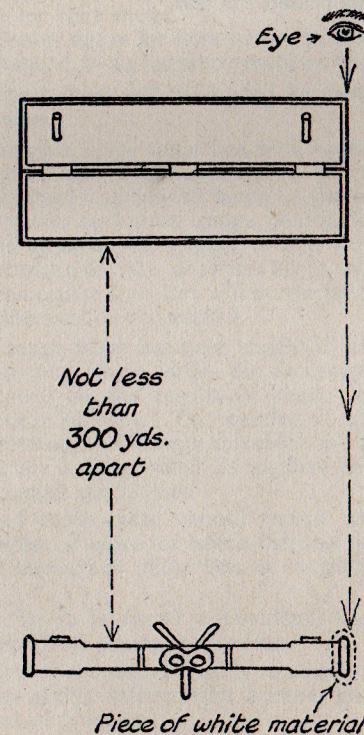


Fig. 12.—Diagram showing method of aligning case parallel to instrument.

3. The case must also be parallel to the range-finder, and it will be aligned in the following way (Fig. 12). A handkerchief will be hung on one end of the range-finder, and the range-finder turned so that the lath is in the centre of the field of view. The corners of the half-opened case will be aligned on the handkerchief, and the supporting rod dropped to hold the case open with the lath facing the range-finder.

4. The lath must not be used for adjustment unless it has passed the test, given in Appendix II, to ensure that it is the same length as the base of the range-finder.

5. The lath should not be used for adjustment if any of the other means are available, because a very small error in the length of the lath makes a considerable error in adjustment. On service, however, it is likely that the lath will be the only means of adjusting the instrument, and it is sufficiently accurate if it has passed the test.

SECTION 9.—ACCURACY CHARTS

1. Accuracy charts are records of the accuracy of ranges taken by the range-taker, and of the adjustment he used to obtain each range. They also show the conditions under which each range was taken.

2. The information recorded on the chart (Fig. 13, page 28) is :—

- i. The name of the range-taker.
- ii. The number of his instrument.
- iii. Along the foot of the chart, the date, weather conditions and type of object to which the range was taken.
- iv. Near the top of the chart, on each vertical line, the coincidence adjustment setting used for that series.
- v. Along the centre line of the chart, the coincidence adjustment setting which would have given a perfect result for that range.
- vi. The accuracy figure for each range, plotted in its position with regard to an accuracy scale on the left.

3. An accuracy chart will be started for each man after the fourth day's work.

4. Until a recruit range-taker has been taught to adjust his instrument by means of a single series, the accuracy figure plotted on his chart will be the mean of the accuracy figures of all ranges taken to known range points during one day's practice. The adjustment setting, which would have given him a perfect mean for the previous day's work, will not be recorded on the centre line, but will be the setting used during the whole of the next day's practice.

5. When a range-taker has been taught to adjust his instrument by means of a single series, the accuracy figures plotted on his chart will be the results of single series on known range or infinity objects. The results of all ranges taken need not be entered, but merely sufficient to show his progress and to record the setting which he requires on his instrument under the recorded conditions.

6. A trained range-taker should record on his chart the consistency figure of series for which this has been worked out. A convenient method of doing this is shown on the specimen chart.

7. As soon as it is found convenient, the men may be taught to keep these charts themselves.

8. These charts should be readily accessible to the men, as their value in giving information is even greater than their value as a test of progress.

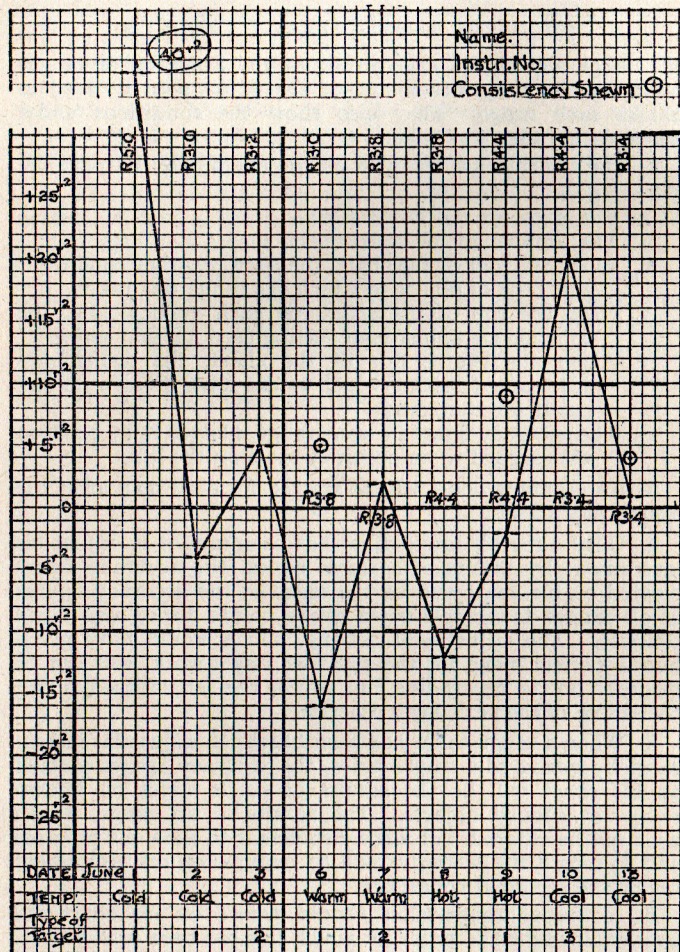


Fig. 13.—Accuracy chart.

NOTE:—The types of target are numbered to represent:—

1. Easy straight-edged objects.
2. No definite straight edge (bush, bank, etc.).
3. Difficult service targets.

SECTION 10.—THE RANGE-TAKER'S NOTEBOOK

1. Accuracy charts, though extremely valuable, are impracticable on active service as a record of the Coincidence Adjustment Setting.

They should, however, be used throughout training and kept by the officer appointed to supervise the range-takers in the battalion.

2. A small notebook, of a size which will fit into one of the pockets in the canvas cover, will be kept by each range-taker, in which he will record his coincidence adjustment setting (C.A.S.) for all types of weather conditions.

3. The range-taker's notebook should be divided into four parts, so that the settings required for varying degrees of hot, warm, cool, and cold weather may be recorded in their respective sections.

Sample pages would read thus:—

	(1)	(2)	(3)	(4)
Date ...	March 1941	May 1941	July 1941	Oct. 1941
Temp. ...	Bitterly cold	Warm	Extremely hot (almost tropical)	Cool (slight frost)
Visibility ...	Poor, slight mist	Very clear	Fair, rather hazy	Clear
C.A.S. ...	L 5.8	L 3.2	L 2.8	L 4.5

4. The coincidence adjustment setting recorded will be the setting arrived at after adjusting to within $\pm 5'$ on a known range,* when consistency is normal.

5. The detail against temperature and visibility should be as full as possible, in the man's own words.

6. The range-taker's notebook should contain a large number of recordings for all variations of weather and visibility, and will prove invaluable on those occasions when adjustment by the normal method may be impossible.

* Natural or artificial infinity.

SECTION 11.—CONSISTENCY

Lesson 10.—Calculation of consistency

Instructor's Notes

Work out on the blackboard one or two examples on the yards and infinity part of the scale.

The class work out their own C.F. for some of their previous series.

Do not labour consistency. It is possible for a range-taker to be accurate although not consistent. However, it is probable that his consistency will improve in line with his accuracy.

No effort should be made to bring down the consistency figure of a man whose accuracy figure is satisfactory, because it is not desirable to encourage a man to try too hard to make every coincidence perfect. Each man should note the normal consistency figure with which he gets good accuracy.

When consistency figures are worked out for a series of which the accuracy figure is put on the man's chart, the consistency figure should also be plotted on the chart in the manner shown on the specimen chart.

1. Consistency is the "size of the group" of readings. When taking ranges in the field under bad conditions, if there is sufficient time, such as in defence, the range-taker must work out the consistency of his series to discover the probable accuracy of the result. Conditions may exist where the ranges he takes are unreliable, and he must know whether this is so or not.

It will be found that the normal consistency figure of a trained range-taker is about $5r^2$ in good conditions. This may vary slightly with different men, the standard set being in accuracy and not in consistency. In bad conditions, however, the consistency figure and the accuracy figure will vary.

Any large variation in the consistency figure should warn a range-taker to suspect the accuracy of the series.


2. Examples of the calculation of consistency:—

Range scale		Infinity scale	
Reading	Residual	Reading	Residual
1850	11	—	0.8
1840	1	0.6	0.8
1880	41	—	0.4
1810	29	—	1.0
1840	1	0.2	0.4
1870	31	0.8	1.0
1850	11	0	0.2
1810	29	—	0.2
1800	39	0	0.2
1840	1	—	0.6
10)18390	10)194	plus 1.6	10)4.8
1839	19.4	minus 3.2	0.48 (Mean residual)
(M.O.R.)	(Mean residual)	10)minus 1.6	—0.16 (M.O.R.)
Consistency $\frac{19.4}{r^2}$ of M.O.R.		Consistency figure 0.48×10	
$= 6r^2$		$= 4.8r^2$	

Notes on the infinity calculation.

(1) The M.O.R. is taken only to one place of decimals (in this case, — 0.2 for — 0.16) in calculating the residuals. This saves labour, and is sufficiently accurate.

(2) If any difficulty is experienced in calculating the difference between the M.O.R. and readings with the opposite sign, or infinity itself, a diagram should be drawn of the range scale with an arrow at the position of the M.O.R. The distance of the arrow from the position of each reading should then be apparent.

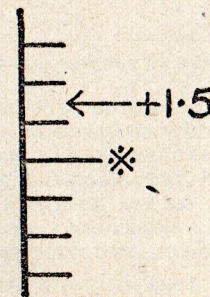

SECTION 12.—RANGE CARDS

Lesson 11.—Construction of range cards

Instructor's Notes

The construction of range cards can be practised in three ways :—

1. Give the class figures from which to construct a range-card indoors.
2. Mark on a sand table the range-taker's position and six points which are required on a range-card. Each range-taker will measure the ranges by a ruler or a scale on the side of the table, judge or measure the angles, choose his own setting ray, and make out the range card form and range card.
3. Give six easy objects outside. Each man will take the ranges and make out his range card form and range card. The ranges need not be known ranges, but any range which differs greatly from the average to that point should be investigated. No time limit should be given at first, but any waste of time should be discouraged.

1. Detailed description of range cards and the method of recording ranges on the card are contained in Pamphlet No. 2 of this series.

2. Before completing the range card, range-takers should prepare and complete the form described in Appendix VII, para. 3. From this detail the range card can be constructed under cover.

SECTION 13.—TAKING RANGES UNDER DIFFICULT CONDITIONS

Lesson 12.—Difficult objects

Instructor's Notes

Give three or four difficult targets. When the class have taken the ranges, question them as to the methods used and discuss the best.

1. Where no portion of the object to which the range is required is a straight line, it will not be possible to make coincidence as described in Sec. 7. In this case it will be necessary to choose a distinct mark on the object, and bring the two images of that mark so that they touch the dividing line in the centre of the field of view, without actually cutting the line (see Fig. 14). A series of "coincidences" will be made in this way alternately from right and left as before. The more accurate the halving adjustment the easier and more accurate will be the making of coincidences. Accuracy will not be so good as when a straight line is available, and, where the point is not very distinct, the consistency of a series should be worked out to discover whether the range is reliable or not.

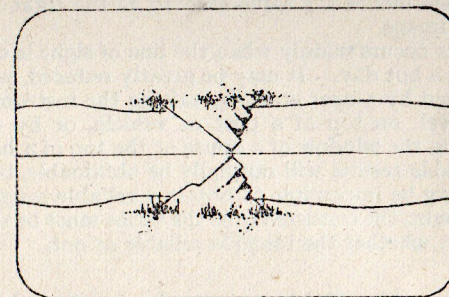


Fig. 14.—Showing coincidence by symmetry of images.

2. A moderating glass is provided in the right eyepiece, which may be used to moderate very bright light, or to make the view clearer in mist. The range-taker may use it whenever he likes, and, if the light is unpleasant, he should try the glass to see if it helps. The glass has no appreciable effect on accuracy, but the more comfortable the conditions are for the range-taker the more accurate are his readings likely to be.

3. The astigmatizers must be used for adjustment on a

star, and for taking the range to a light at night. They will also be of assistance in taking the range to a light patch, such as a white stone, by day.

If the range is required to an object on which there is no definite point on which to make coincidence, the astigmatizers should be tried. It will sometimes be found that a mark on the object is drawn out into a light or dark line on which it is easy to make coincidence, but care must be taken that the line is formed by a mark on the required object, and not by some mark nearer or farther away than the object, which might appear to be a line crossing the object required.

Lesson 13.—Taking ranges in rain and shimmer

1. Rain does not affect accuracy unless it is entering the front windows of the instrument. Under these conditions it is impossible to obtain a reliable range, and the instrument must be protected by going under the lee of a haystack or into a shed, or by improvising some form of shelter.

2. Shimmer is the rising of hot air from the ground. It causes the two images to vibrate independently of each other, and it becomes very difficult to make coincidence.

When images, owing to shimmer, are not stationary, the only method of judging a coincidence is by deciding that the upper image moves the same amount to the right and left of the lower image.

Shimmer occurs mainly when the line of sight is close to the ground on a hot day. It may be greatly reduced, particularly when caused by a near crest, by raising the instrument above ground level, on top of a post or vehicle, or by taking the ranges from the window of a house or the top of a haystack.

Reasonable results will normally be obtainable, but in some cases it may be impossible to obtain a reliable range. Where there is doubt, the consistency of the series must be worked out to discover whether the range is reliable or not.

Lesson 14.—Taking ranges to moving objects

1. It is impossible to obtain a series of readings to a moving object, as the actual range alters between readings. Also, it is impossible to obtain a reliable range unless a series of readings has been taken.

2. The range must therefore be taken to some point near to which the moving object will pass, and the fire controller must be given this range in time to allow him to give an anticipatory fire order on this point. Ranges already on a range card may be available for use in this way.

3. If it is impossible to obtain the range to a point ahead of the moving object, as would be the case with an object at sea, each reading taken to the object itself will be called out to the fire controller or to an assistant. A reliable range will not be obtained, but to some extent the readings will check each other, and a rough estimate of the correct range will be obtained.

SECTION 14.—CONCEALMENT AND FIELD DUTIES

Lesson 15.—Positions and concealment

Instructor's Notes

1. Show different positions, and practise class.
2. Practise class taking ranges from different pieces of cover, insisting that the steadiest position possible is always taken up.
3. Class take the same range both lying and in some other position, and work out the consistency of the two series to compare their probable accuracy.

1. The range-finder is very difficult to conceal, because it must be set up so as to give a clear view from both windows, and, being a straight object, it is easy to see.

The range-finder can sometimes be concealed behind a bush or a tree, with one window looking round each side. When this is not done, the background must be considered, and skylines particularly avoided. The straight line of the instrument must be broken, whenever possible, perhaps by placing a piece of bush in front, and at times it may be necessary to use the range-finder at some distance from the section position.

2. A lying position should be used, if possible, because it is the steadiest and most comfortable. If this is not possible, the instrument may be used sitting, kneeling or standing, but accuracy will be less, and, where there is doubt, the consistency of the series must be worked out to ensure that it is reliable. Whichever position is used, the stand of the range-finder and the elbows of the range-taker must be rested, even if only on the range-taker's chest, and the instrument or the man's body or leg must be rested or steadied in the best possible way.

Lesson 16.—Field duties

Instructor's Notes

Explain duties in various roles and question class. Arrange exercises without troops, instructor acting as section commander, one of the class as orderly, etc., while the remainder of the class watch and criticize. Stop the exercise where necessary to bring out the points required. Exercises should be carefully worked out beforehand, and should include all the roles of a machine gun platoon.

1. The field duties of the medium machine gun platoon are given in Pamphlet No. 7 and those of the 3-inch mortar platoon in Pamphlet No. 9 of this volume. They are taught in headquarters training, but the range-taker should have a sound groundwork before he does headquarters training, and instruction must therefore be included in range-taking training.

2. The range-taker is responsible for the following :—

- i. Checking the adjustment of his instrument at frequent intervals by the best means available.
- ii. Ensuring that his astigmatizers and lath are in order, by putting them through their tests occasionally (Appendix II).
- iii. Writing down all series in such a way that they can be checked afterwards, or the number of readings increased.
- iv. Knowing or asking the time available to take ranges, so that he can decide on the number of readings to take.
- v. Never giving a range unless he has taken at least four readings, and found the mean on paper.
- vi. Warning the fire controller when he suspects that a range is not accurate, because of difficult target or conditions, and calculating the consistency so that he can give some idea of its probable accuracy.
- vii. Giving all ranges as he obtains them. He will not give them to the nearest 50 yards, and will not correct them for his distance from the fire controller unless specially ordered.
- viii. Reminding the fire controller to correct ranges for the range-taker's distance from the gun position, when necessary, by giving the range as "so many yards from here."
- ix. Observing fire, giving the fire controller the distance in yards of strike from the target. If strike is not visible, taking the range to the target.
- x. Making out a range card whenever he has time, and giving it to the fire controller. This is an exception to vii., above; the ranges on the card will be corrected for the position marked on the bottom of the card, which will normally be the gun position, but they will still be given as accurately as possible, not to the nearest 50 yards.

3. The range-taker should be practised in indicating objects both as seen by the naked eye and as seen through his instrument, the latter to be recognized by the fire controller using field glasses.

In certain circumstances it may be advisable to send the range-taker under cover, after he has obtained the necessary ranges, both to protect a valuable man and instrument, and to hide the instrument from enemy observation. The instrument is, however, a very good telescope, and it may sometimes be an advantage to use the range-taker as an observer when no more ranges are required.

Whenever possible and especially to observe fire, some knowledge of beaten zones is required, and the range-taker should be given every opportunity of practising observation of fire, during the firing of Parts III and IV of the Medium Machine Gun Course (War) and the Mortar Range Course (War), see Pamphlet No. 18 of this volume.

The fire controller is at all times responsible for detailing the points to which he requires the range taken by the range-taker, as the fire controller is the one who is in the best position to do this; he is more in the tactical picture.

A range-taker should, however, take every opportunity, when not otherwise required for observation purposes, etc., to improve the arc of fire by taking ranges to other objects.

4. The range-taker must work with the fire controller as a team. He should know what orders to expect, and what his duties will be. A brief summary of his duties is:—

- i. *Attack*.—Takes ranges while the section commander selects gun and control positions, but may be some distance from section area. He must return in time to give range to first target when required, and then may be ordered to complete range card, to observe fire, or to go back under cover.
- ii. *Defence*.—Construct a range card. An extra range card may be required for riflemen from the alarm post. Both cards to be improved and checked frequently. He will have to take his place on the N.C.Os.' or men's duty roster.
- iii. *Withdrawal*.—Longer ranges are required at first. The range-taker may have to select points for his own card, when sent back to an intermediate position.
- iv. *Indirect fire*.—One range-taker is required by the platoon commander, the other by the senior section commander at the gun position.

SECTION 15.—RANGE-TAKERS' TESTS

General

1. A trained range-taker should work to an accuracy figure (A.F.) of $8r^2$ in good conditions, and in training he should seldom be above $16r^2$. On service, conditions are likely to be worse than in training, and an accuracy figure within $25r^2$ will satisfy the machine gun fire control and safety rules.

An examination of each range-taker's accuracy chart will show whether he is normally within these figures, and, if he is, he is fit to undergo the annual test.

2. Two tests will be passed annually by each range-taker:—

i. *Test of elementary training*.—Each range-taker to be passed during the individual training period under company arrangements. The recruit range-takers should pass this test during their third week of training. A man may repeat the test until he passes.

ii. *Annual test*.—To be carried out annually under infantry brigade and machine gun battalion arrangements during suitable weather. Any man who fails to reach first-class standard may be retested once only before the end of the weapon training year, and his qualification will be the highest that he has attained in the test or retest.

3. Commands will assist in the arrangements for the range-takers' tests. Application for survey of ranges should be made in sufficient time to allow the survey personnel to choose the most suitable time for their work, with regard to their own training programme.

Methods of obtaining known ranges are given in Appendix III. The work should be entrusted only to an officer who can calculate the unavoidable errors in his figures, and a surveying officer should always be required to state the maximum error of the ranges which he provides.

4. All ranges found for tests should be carefully recorded in the form given in Appendix III, and the exact position from which they were found should be marked on the ground. Ranges for tests should be taken from as sheltered a position as possible, the direction should not be towards the sun, and it is an advantage if the line of sight passes over a valley to avoid shimmer. It is advisable, if ranges are likely to be required for subsequent tests, that they should not become known to men undergoing tests.

5. Including the adjusting ranges, two ranges are required for the test of elementary training and nine for the annual

test. If newly surveyed ranges are not available, both tests may be conducted with falsified ranges. These falsified range tables are shown at Appendix VIII. Alternatively, for the T.E.T. only, a N.C.O. may be placed in front of the range-taker under test to check his readings through the front range scale window.

In calculating values of r^2 , sufficient accuracy is obtained if r is regarded as the range in thousands of yards to the nearest decimal place.

Test of elementary training

6. Part 1. Oral test.

About five questions will be asked on care and cleaning, methods of taking ranges and adjusting instrument, field duties, etc. The qualifying standard will be 60 per cent, and the man will be recorded as "pass" or "fail."

7. Part 2. Practical test.

The man will be shown two good straight line objects between 2000 and 3000 yards, in approximately the same direction. He will be told the true range to one of them. The range should be known to within r^2 .

He will then adjust his instrument on the point to which he has been given the range and take the range to the other point. This range should be known to within $2r^2$.

The man will be marked as "pass" if his accuracy figure is $8r^2$ or less and his time for adjustment and taking the range 20 minutes or less; otherwise, "fail."

Conduct of annual test

8. Not more than 12 men will be tested at one time. A separate base may be used for adjusting instruments, if this has been surveyed. Each detail of 12 men should take about 50 minutes, or 35 minutes for details after the first if a separate base is used for adjustment.

9. The following stores are required for the test :—

Six directors.

About 30 yards of rope for each base.

Three stout pegs for each base to be marked.

One stop watch.

Record sheets, according to the number of men to be tested.

Tape, 2 yards (for marking off the rope at six-foot intervals.

Tab, 9-inch (for placing on the directors (see Appendix VI, para. 3, ii).

Paper and boards.

10. From the centre of the base, which must be the marked and surveyed point, a right angle to the centre of the arc containing the targets is measured and marked with rope.

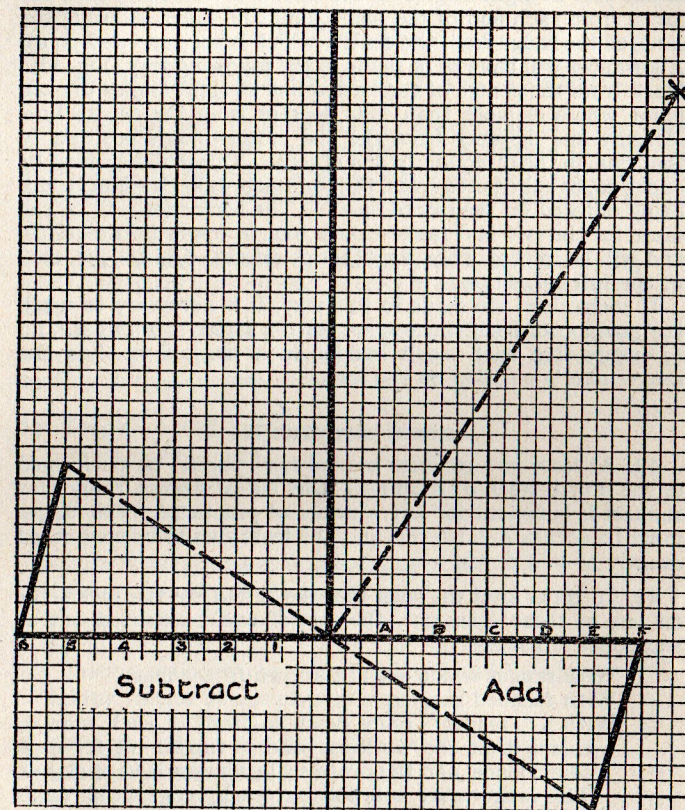


Fig. 15.—Calculation of allowances for objects outside 4° arc from line at right angles to centre of base line. These allowances will be added to or subtracted from the ranges obtained by the range-taker.

A length of tape is tied to the rope at each six feet from the centre to mark the position of each range-taker. Six positions are marked on each side of the centre peg. If a separate

base is used for adjustment, this is marked out in the same way, at right angles to the line to the adjusting point.

11. If any object used in the test is not within four degrees of the line at right angles to the centre of the base, then the range from each end of the base cannot be taken as being the same as the range from the centre, which is the surveyed point. Allowances will have to be made in the following way (Fig. 15): Mark from the centre of the base a line at right angles to each point which is more than four degrees from the centre line. Measure the distance from the end range-taker's position to that line, in the direction of the object. This distance must be added to, or subtracted from, the end range-taker's result before being entered on the record sheet. The correction will be the same for the two end range-takers, but in opposite directions, and will be in proportion for other positions—5/6, 4/6, 3/6, etc., of the full correction.

If corrections are made in this way, it is necessary to mark the position of each range-taker with a letter or number, and to ensure that each result handed in is marked to show the range-taker's position on the line.

Annual test practice

12. At least two practice annual tests should be performed in the fourth week of training. One set of known ranges for the test is sufficient for any number of practices. The ranges must be accurate, however, and the tests should be conducted exactly as laid down.

13. In order that the men may be tested by the instructor on one of these occasions, the test should be carried out at least once either :—

- i. With ranges which are not known to the men.
- ii. With falsified ranges.

iii. With a "reader" lying down in front of each man to ensure that the working head is turned off for each coincidence, and the range scale window is kept closed. The range-taker will call out each range as he reads it, and both he and the reader will write it down. The reader will also check each reading through the front range scale window.

APPENDIX I

A SUGGESTED SYLLABUS OF TRAINING

1. The last half-hour of each day's work should be devoted to : (i) working out the day's results, (ii) revision of all previous work, and (iii) short talks on such subjects as the importance of making coincidence from alternate sides, or the effect of bad halving, etc.

2. The hours allotted to taking ranges are necessary for increasing accuracy and skill in the use of the instrument in the field.

The number given in each stage is considered to be the average which will be required. They may be varied according to the progress of the class.

Hours

1st Stage—About four days

Introductory lecture	1
General description—Packing and unpacking (Lesson 1)	2
Care and cleaning (Lesson 2)	2
Setting up instrument and focusing (Lesson 3)	1
Making coincidence (Lesson 4)	2
Halving adjustment (Lesson 5)	1
Calculating accuracy. Figure and coincidence. Adjusting scale setting. (Appendix V and Lesson 6)	3
Taking ranges to complete stage	8

2nd Stage—About five days

Accuracy charts (Sec. 9)	2
Making range cards (Lesson 11)	6
Taking ranges in rain and shimmer (Lesson 13)	1
Taking ranges to complete stage	16

3rd Stage—About four days

Coincidence on difficult objects (Lesson 12)	1
Calculation of consistency (Lesson 10)	2
Making range cards (Lesson 11)	6
Taking ranges to complete stage	11

Hours

4th Stage—About six days

Adjustment on known range (Lesson 7)	1
Practice adjusting instruments on known range	4
Adjustment on infinity (Lessons 8 and 9)	1
Practice adjusting instrument on natural infinity	2
Practice adjusting instruments on Artificial Infinity... ..	4
Test of elementary training (Sec. 15)	2
Instrument tests (Appendix II)	2
Annual test practices (Sec. 15 and Appendix VII)	6
Taking ranges to complete stage	8

5th Stage—About five days

Use of cover and positions (Lesson 15)	2
Taking ranges to moving objects (Lesson 14)	3
Field duties (Lesson 16)	8
Taking ranges to complete stage	12

APPENDIX II

INSTRUMENT TESTS

1. The two tests given below provide a means of testing the astigmatizers and lath in the field, and a range-taker must never adjust his instrument on a star or on the lath unless he knows that his instrument will pass the appropriate test.

These two tests are supplementary to the annual test of instruments given in the Handbook of the Range-Finder, No. 12, 1933. The annual test requires the use of known ranges which will not be available in the field, yet the astigmatizers and lath must be tested.

i. The test of the astigmatizers.

Choose an object on which good coincidence can be made with or without the astigmatizers in use.

Take a series of 20 readings, in pairs, alternately with and without the astigmatizers.

The mean of the ten readings with the astigmatizers should not differ from the mean of the ten readings without them by more than $8r^2$ of the M.O.R. of the series taken without the astigmatizers.

Example.

A with astigmatizers	M.O.R. 1274
B without ,,	M.O.R. 1262
	<hr/>
	12

$$\text{Divide by } r^2 \text{ of B} = \frac{12}{1.3^2} = \frac{12}{1.7} = 7r^2.$$

ii. The test for difference in length between the adjusting lath and the base of the range-finder.

Adjust the instrument on a natural infinity (moon by day). Set up the lath at about 200 yards from the range-finder, great care being taken that it is parallel to the base of the instrument.

Take a series of ten readings on the lath. The accuracy figure should be less than $10r^2$ (one division).

2. As in the adjusting of his instrument, the range-taker should work out the consistency of the series taken, to ensure that the results are reliable.

APPENDIX III

EXAMINATION AND TEST OF
RANGE-FINDERS

A.—EXAMINATION

This examination will be carried out periodically in the unit to ensure that the instruments are free from such defects as can be ascertained without dismantling. It will also be carried out before the annual R.A.O.C. inspection of range-finders.

Procedure

i. Examine the range-finder to see that it is complete—no screws missing, etc.—and that there are no dents in the outer tube.

The revolving rings (Mark III) should move smoothly.

ii. Examine the lath adjusting to see that no damage or excessive wear has occurred.

iii. The case, canvas cover, and stand should be in a serviceable condition.

iv. Uncover the end windows and direct the eyepiece towards the light. On looking into (not through) the windows, the optical parts should appear clean and unclouded.

v. Mount the range-finder on the stand. The range-finder body should rotate freely in the rings of the carrier plate. Direct the instrument to the sky, avoiding the sun, and focus the dividing line. The upper and lower fields of view should appear clean and free from dust or filming.

vi. Depress the instrument on to a distant object. The images in both fields of view should be sharply in focus.

vii. The coincidence adjusting head (Mark III) should move in and out freely, and the coincidence adjusting head (Mark IV and V), and the halving adjusting head (all Marks), should move with decided clicks.

The working head should move freely. It should be possible to feel a slight freedom between it and its pinion, which is mounted on the inner frame.

The focusing adjustment should work smoothly.

The moderator disc and cover for left eyepiece (Marks IV and V) should rotate freely, and the moderating glasses should be clean.

The astigmatizers should snap in and out with a decided action.

viii. Set up the lath at 300 to 500 yards (*see* Lesson 9). Adjust the range-finder on the lath. If the coincidence adjusting scale by the left window reads more than 12 divisions from 0, the range-finder should be returned to R.A.O.C. for correction.

ix. Place the astigmatizers in action. The fields should remain clear and without shadows.

x. Should the range-finder be found defective in any way, minor repair and cleaning may be carried out by the armourer, if workshop conditions and tools allow.

Otherwise the instrument will be returned to the R.A.O.C. Detailed testing is carried out by R.A.O.C. after repair.

After repair by the armourer, instruments will be tested by range-takers.

B.—TEST

Immediately before the annual R.A.O.C. inspection of range-finders, testing will be carried out by qualified range-takers under the supervision of an officer who has qualified in the range-finder course at the Small Arms School, Netheravon, Ahmednagar, or at the Military College of Science, Woolwich. The results of this test, and any defects or doubtful points, will be brought to the notice of the O.M.E.

A range-finder will also be tested at any time that inaccuracy is suspected.

The object of the test is to ascertain that the range-finder, when adjusted, will give ranges to the expected degree of accuracy. The test must be carried out deliberately, and only under good conditions of weather and observation.

Each instrument will be tested by two qualified range-takers. If any instrument fails in the following test, a report, showing the results obtained, will be forwarded to the A.D.O.S. of the Command.

The following tests are the only tests to be carried out in the unit. Detailed tests to identify particular faults are applied by R.A.O.C. and C.I.A.

Procedure

i. Select two easy targets, one about 1000 yards and one between 4000 yards and 6000 yards. The ranges from the testing position to the points must be known to within r^2 .

ii. Adjust the instrument on the longer range.

iii. Set up the lath adjusting (*see* Lesson 9). The mean deviation of a series of ten readings on the lath should be less than $10r^2$ (one division).

iv. Take a series of ten readings on the shorter range. The mean deviation should be less than $8r^2$.

N.B.—The mean residual will be calculated to check the consistency of each series taken. If this exceeds the man's normal consistency figure the test is not reliable.

v. Repeat test iv. with the astigmatizers in action. The mean deviation should be less than $8r^2$.

vi. "Rough treatment," which should consist of shaking the instrument thoroughly in the hands, without dropping or jarring, should be applied, and test iv. repeated.

APPENDIX IV

DETERMINATION OF KNOWN RANGES

1. Known ranges are necessary for the training of range-takers, and it must be ensured that they are known with sufficient accuracy.

No known range should be used in training or in tests unless there is a record of how it was obtained, and of the maximum error. The maximum error must be:—

- i. For adjusting the instrument—less than r^2 .
- ii. For testing the man—less than $2r^2$.

During the first stages of training, ranges may be used which are not so accurately known, but the maximum error must always be small compared with the error which the man may make.

2. In general, the determination of ranges should be entrusted to a surveyor, or an officer who has some knowledge of the errors which he may expect to make. Some idea of the methods of calculating these errors is given below.

When found, all ranges should be recorded in a book, showing the method by which they were obtained and the maximum error. The two ends of the range should be adequately described and, if necessary, should be marked on the ground in some permanent way.

3. **Measurement by survey.**—This is the most satisfactory method, where military survey personnel are available. The accuracy required should be specified before the survey, and the accuracy obtained must be given by the surveying officer.

4. **Calculation from trigonometrical co-ordinates.**—A list of trigonometrical points and their co-ordinates may be obtained from command headquarters. The distance between any two of these points may be found by calculation, as follows: Subtract the east co-ordinates and subtract the north co-ordinates. The two figures obtained are, in metres, the lengths of two sides of a right-angled triangle; the third side is the range required, and this can be calculated and converted to yards. The maximum error in the trigonometrical points will be less than one foot.

A range found in this way may be altered by means of the steel tape and range-finder methods described below.

5. **Measurement with steel tape over flat ground.**—This method is not accurate over long distances without the use of special instruments, but it can be used for the measurement of distances up to 250 yards in increasing or decreasing

a surveyed range. The maximum error may be taken as the sum of the maximum errors of the survey and of the measurement by tape. The error in using a steel tape is not likely to exceed 1 per cent.

Example.

Surveyed range of 2000 yards. Maximum error stated by surveyor to be (say) ... 3 yards.
 200 yards measured away from base.
 Maximum error of measurement ... 2 yards.
 Maximum error of new range of 2200 yards is therefore 3 plus 2 yards = 5 yards.
 As 5 yards is $1\frac{1}{2}\%$ of 2200 yards, the new range is known to within $1\frac{1}{2}\%$.

6. Measurement with the range-finder.—The maximum error of a trained range-taker in good conditions on a good object immediately after adjusting his instrument is $8r^2$. This is not sufficiently accurate for practising other men, but greater accuracy may be obtained by the following methods.

When using methods i. and ii., to ensure that there is no unusual error, it is advisable for two trained range-takers to take the ranges, and for them to check the adjustment of their instruments again afterwards.

i. A surveyed range may be increased or decreased by a distance of more than 250 yards in the same way as with a steel tape (*see* para. 5, above). In calculating the maximum error of the new range, the error of the range-finder on the distance is taken to be $8r^2$.

ii. If a fairly long range is taken in sections, it will be found that greater accuracy is obtained. For instance:—

Error in taking a range of 2000 yards ($8r^2$ of 2000), 32 yards; but error in taking half the range ($8r^2$ of 1000), 8 yards.

So, if the two halves were taken and added together, the error will be only 16 yards, instead of 32 yards.

The more sections taken the more accurate will be the range. If a range is taken in four approximately equal sections, the accuracy will be within $2r^2$, and, if in eight sections, within r^2 .

This method will only be possible on flat ground.

iii. If a range is taken several times on different occasions, or by different range-takers, the mean of all the series will be more accurate than if only one series were taken. The accuracy increases as the square root of the number of series, so to obtain an accuracy of $2r^2$

the mean of 16 series must be taken, and to obtain an accuracy of r^2 the mean of 64 series is required.

This method of finding known ranges will be found very useful, because it is only necessary to collect the results of trained range-takers in their normal practice over a sufficiently long period, and a great number of ranges will be obtained. It must be ensured that every series used is by a trained man, on a good object, and immediately after adjusting his instrument.

7. Measurement from a map.—Maps do not give ranges with great accuracy. When used, they must be clean and unfolded, and points must be accurately located. The chief error is likely to be the distortion of the map, and this must always be allowed for by one of the methods described below.

i. On a gridded map, read the co-ordinates of the two ends of the range required as accurately as possible, and then calculate the range in the manner described in para. 4, above. This method automatically allows for most of the distortion of the map.

ii. Make several measurements with a ruler measuring in one-fiftieth inch, or graduated in yards and feet, and find the mean of all the measurements taken. Distortion must then be allowed for, and this will normally be different in different directions of the map. If two trigonometrical points can be selected in approximately the same direction as the range measured, the distance between these should be measured on the map, and the true distance calculated as described in para. 4, above. The difference between the calculated and measured distances will show the error of the map in that direction, and the measured range can be altered in the same proportion.

When the range has been taken from a map by either of these methods, the error can be taken to be 0.04 inch. On a 6 inches to the mile map this represents 11.7 yards, and on a 25 inches to the mile map it represents 2.8 yards. Thus on the 6-inch map only ranges of over 3400 yards can be found to within r^2 , and ranges over 2400 yards to within $2r^2$. The 25-inch map gives the same accuracy at about half these ranges.

There are certain aids to measurement, such as a travelling microscope, which will increase the accuracy obtained, and these should be used whenever possible.

APPENDIX V

VALUES OF r^2

1. All errors in range-taking are given in terms of r^2 , which is the square of the range in thousands of yards. The following example shows the method of calculation.

Range, 1700 yards. r^2 is 1.7×1.7 . 2.9 yards,

Error, 20 yards, which is $\frac{20}{2.9} r^2$, or $7r^2$,

where the error given may be either a mean deviation (accuracy) or a mean residual (consistency).

For convenience in working out accuracy and consistency figures in training, a table of "values of r^2 " is given in this appendix, and a calculator is issued for the use of instructors.

2. Instructions for using table of values of r^2 .—

The range is given on the left of the table, the accuracy figure (A.F.) or consistency figure (C.F.) along the top, and the number of yards in the body of the table.

Example.

i. Required— $14r^2$ at 1450 yards.

At 1450 yards $10r^2$ is 21 yards.

$4r^2$ is 8 yards.

so $14r^2$ is 29 yards.

ii. Required—the A.F. or C.F. for 99 yards at 2750 yards.

At 2750 yards 76 yards is $10r^2$

remainder 23 yards is $3r^2$

so 99 yards is $13r^2$

3. Use of range-taking calculator.—

Set the " r^2 " arrow on the foot of the slide against the range. Then the A.F. or C.F. at the top of the slide will be opposite the number of yards on the upper scale of the rule.

Example.

Range 2120 yards (set arrow as near as possible).

$6r^2$ (6 on the slide) is 27 yards (on upper scale);

and 40 yards (on upper scale) is $9r^2$ (9 on slide).

VALUES OF r^2

Range	r^2								
	1	2	3	4	5	10	15	20	25
600	0	1	1	1	2	4	5	7	9
50	0	1	1	2	2	4	6	8	11
700	0	1	1	2	2	5	7	10	12
50	1	1	2	2	3	6	8	11	14
800	1	1	2	3	3	6	10	13	16
50	1	1	2	3	4	7	11	14	18
900	1	2	2	3	4	8	12	16	20
50	1	2	3	4	5	9	14	18	23
1000	1	2	3	4	5	10	15	20	25
50	1	2	3	4	6	11	17	22	28
1100	1	2	4	5	6	12	18	24	30
50	1	3	4	5	7	13	20	26	33
1200	1	3	4	6	7	14	22	29	36
50	2	3	5	6	8	16	23	31	39
1300	2	3	5	7	8	17	25	34	42
50	2	4	5	7	9	18	27	36	46
1400	2	4	6	8	10	20	29	39	49
50	2	4	6	8	11	21	32	42	53
1500	2	4	7	9	11	22	34	45	56
50	2	5	7	10	12	24	36	48	60
1600	3	5	8	10	13	26	38	51	64
50	3	5	8	11	14	27	41	54	68
1700	3	6	9	12	14	29	43	58	72
50	3	6	9	12	15	31	46	61	77
1800	3	6	9	13	16	32	49	65	81
50	3	7	10	14	17	34	51	68	86
1900	4	7	11	14	18	36	54	72	90
50	4	8	11	15	19	38	57	76	95
2000	4	8	12	16	20	40	60	80	100
50	4	8	13	17	21	42	63	84	105
2100	4	9	13	18	22	44	66	88	110
50	5	9	14	18	23	46	69	92	116
2200	5	10	15	19	24	48	73	97	121
50	5	10	15	20	25	51	76	101	127
2300	5	11	16	21	26	53	79	106	132
50	6	11	17	22	28	55	83	110	138
2400	6	12	17	23	29	58	86	115	144
50	6	12	18	24	30	60	90	120	150
2500	6	12	19	25	31	62	94	125	156
50	7	13	20	26	33	65	98	130	163
2600	7	14	20	27	34	68	101	135	169
50	7	14	21	28	35	70	105	140	176
2700	7	15	22	29	36	73	109	146	182
50	8	15	23	30	38	76	113	151	189
2800	8	16	24	31	39	78	118	157	196
50	8	16	24	32	41	81	122	162	203
2900	8	17	25	34	42	84	126	168	210
50	9	17	26	35	44	87	131	174	218
3000	9	18	27	36	45	90	135	180	225
50	9	19	28	37	47	93	140	186	233
3100	10	19	29	38	48	96	144	192	240
50	10	20	30	40	50	99	149	198	248
3200	10	20	31	41	51	102	154	205	256
50	11	21	32	42	53	106	158	211	264
3300	11	22	33	44	54	109	163	218	272
50	11	22	34	45	56	112	168	224	281
3400	12	23	35	46	58	116	173	231	289
50	12	24	36	48	60	119	179	238	298
3500	12	24	37	49	61	122	184	245	306

APPENDIX VI

APPARATUS, TRAINING RANGE-TAKERS

1. This apparatus is designed to allow of the training of the range-taker indoors where outdoor facilities are not available.

The apparatus consists of an arrangement of lenses and mirrors which allows a range to be taken to any photograph, sketch or lantern slide, using an ordinary range-finder.

The apparatus is very inaccurate, because the fitting of the slide or picture to the holder and the type of slide or picture used not only cause a large variation in the general range to the picture but also in the range to different parts of the picture.

The apparatus has a pointer which may be set to "short" "medium" or "long" range, which can be set to give approximately the range which it is desired to record.

2. Training on the apparatus should follow as nearly as possible the sequence laid down for outdoor work.

3. In the first stages of training it will be sufficient to practise the range-taker in taking series without any testing, except that the instructor should sometimes check the readings of the range scale by looking through the left eyepiece.

4. Owing to the inaccuracy of the apparatus, a known range is not available, but the adjustment of the range-finder can be practised in the following way :—

- i. The range-taker takes a series of readings.
- ii. The instructor gives a *true range*, which is about $6r^2$ to $15r^2$ from the *mean observed range*.
- iii. The range-taker works out his accuracy figure, moves the coincidence adjusting head accordingly, and takes another series. The mean observed range should now be within $5r^2$ of the supposed true range.

Notes.—The range pointer on the apparatus must not be moved, and the slide or picture should not be touched, between these two series.

Coincidence must be made throughout not only on the same object but on the same part of the object.

The adjustment found by this means will have no relation to the adjustment required to take ranges out of doors.

5. When it is necessary to adjust the apparatus, this will be done by an armourer, assisted by a trained range-taker. Complete instructions for adjustment are contained in the pamphlet issued with each apparatus.

APPENDIX VII

ANNUAL TEST

1. Immediately before the test, each man will be given unlimited time to adjust his instrument on a known range of between 2000 and 3000 yards. The range to this object, which should have a well-defined straight edge, must be known to r^2 . The test is divided into two parts :—

Part I—Reconnaissance test (attack).

Part II—Taking ranges for a defensive position.

2. Part I.

- i. The object is to test the man's powers of recognition and ability to produce without delay reliable ranges on two natural objects which represent the position of own troops and enemy; the objects to be indicated verbally.

- ii. *Procedure.*—Two directors are laid on objects representing :—

Enemy.—Range between 1500 and 2000 yards.

Own troops.—Range between 1000 and 1500 yards.

There must be at least 200 yards between the two objects.

The objects must be approximately in the same line and reasonably easy to recognize and range on.

The men to be tested will set up their instruments on the testing site and stand up behind their instruments.

- iii. *The test.*—The officer conducting the test will indicate the two objects verbally to the men undergoing the test. Before doing so he will warn them that the indication will not be repeated and that any man who fails to recognize either or both objects from his indication may do so by means of the directors, no extra time being allowed.

At the end of the indication the men will lie down behind their instruments and take the ranges without further orders.

Time limit (timed from the end of the indications) : 3 minutes.

On completion of the test each range-taker will hand to the conducting officer the range to "Enemy" and "Own troops" filled in on a prepared slip.

3. Part II.

- i. The object is to test the man's ability to obtain accurate ranges on a number of natural objects with a view to

transferring the detail subsequently on to a range card. There is a restriction in the time available for obtaining these ranges.

- ii. *Preliminaries.*—Six directors will be laid on objects at the following ranges :—

Three between 1500 and 2500 yards (not more than one over 2000 yards).

Three between 800 and 1500 yards (not more than one under 1000 yards).

Two of the objects will be natural objects without clearly defined vertical edges, such as a bush or bank. The remaining four may be artificial or natural objects with reasonably clearly defined edges.

The objects will be given appropriate descriptions, which will be attached to the directors.

Each man's instrument will be set up on the testing site.

- iii. *The test.*—Each man will be given an opportunity to recognize each object and make necessary notes. He will then stand up behind his instrument.

On the order to begin, he will obtain the ranges to each of the objects. He will select a setting ray within the arcs and on the conclusion of the time limit will hand in his results, tabulated as follows :—

Setting ray.....

Object	Range	Degrees	
		Right	Left

Name.....

Unit

Time limit : 20 minutes.

4. Marking and classification.

- i. Each of the eight ranges will be awarded points as follows :—

	10 points.	5 points.	Minus 5 points.
Part I ... within 20r ²		within 25r ²	more than 35r ²
Part II ... " 15r ²		" 25r ²	" " 35r ²
Possible points, 80.			

- ii. Range-takers will be classified as under :—

1st Class	65 points and over.
2nd Class	50 " " "
Failed	Under 50 points "

- iii. 2nd Class and failed range-takers will be given an opportunity for a retest on a subsequent date.

APPENDIX VIII

FALSIFICATION TABLES

1. Object

The object of the tables is to enable a *deliberately false adjustment* to be put on the instrument. This will make the most accurate range-taker make a known error in the range to any object.

Thus—known ranges are capable of almost infinite variation, and range-takers can be practised or tested on objects to which they may already know the true range.

It should be realized that accuracy charts can only be kept on TRUE ranges, and as many of these as possible should be available.

2. Theoretical explanation

The table shows the angle in seconds measured at the eye by the instrument—base length 80 centimetres—magnification 14 diameters.

If the angle on which the instrument is adjusted is altered by a certain number of seconds, all other angles that the instrument measures will be correspondingly altered. The instrument will then obtain not true but falsified ranges.

3. Practical explanation

The first column shows the true range in tens of yards.

The corresponding angle is shown in the next column headed ANGLE—thus 1000 yards = 2526 seconds.

So far the range has only been found to a multiple of 10 yards. The remaining columns headed 1 to 9 YARDS are used to find the angle for a range correct to a yard.

The last two figures of angle must be replaced by the pair of figures under its respective digit and opposite the tens of yards in question; thus, 1006 yards = 2511 seconds.

The figures relating to the *hundreds* of seconds are bracketed between bars—example:—1011 yards = 2499 seconds.

The alteration made for the adjustment must be maintained throughout the series and must not be divulged.

The alteration in angle should be sufficiently large to ensure that the ranges are appreciably altered, but not so large as to give readings off the C.A.S. adjustment. As a guide—10^r is 24 seconds, and 40 seconds will alter the C.A.S. adjustment by about 1 division.

4. To use the tables

1. Find from the tables the angles measured at the true ranges.

2. Add or subtract the angle by which the series is to be altered.

3. Find in the tables the range corresponding to those angles.

Example:—

Surveyed range to 1st object 2081 yards—Angle (from the Tables) 1214 seconds.

Surveyed range to a 2nd object 1251 yards—Angle (from the Tables) 2020 seconds.

The angle is to be increased by 100 seconds.

i.e. 1214 plus 100 = 1314

and 2020 plus 100 = 2120.

From the Tables 1314 seconds is the angle for 1923 yards
and 2120 " " " " 1192 "

The range-taker is now told that the range at which to adjust on to the first object is 1923 yards. He should then produce 1192 yards as the range to the second object.

RANGE-FINDER No. 12

TABLE OF ANGLE AT THE EYE

Range	Angle	1	2	3	4	5	6	7	8	9 yards
700	33 09	04	99	94	89	84	79	74	69	63
10	35 58	53	49	44	39	34	29	24	19	14
20	09	04	99	95	90	85	80	75	71	66
30	34 61	56	52	47	42	38	33	28	24	19
40	14	10	05	01	96	91	87	82	78	73
50	33 69	64	60	55	61	46	42	38	33	29
60	24	20	16	11	07	03	98	94	90	85
70	32 81	77	73	68	64	60	56	52	47	43
80	39	35	31	27	23	19	14	10	06	02
90	31 98	94	90	86	82	78	76	70	66	62
800	58	54	50	46	43	39	35	31	27	23
10	19	15	11	08	04	00	96	92	89	85
20	30 81	77	74	70	66	62	59	55	51	48
30	44	40	37	33	29	26	22	19	15	11
40	08	04	01	97	94	90	86	83	79	76
50	29 75	69	65	62	58	55	52	48	45	42

Range	Angle	1	2	3	4	5	6	7	8	9 yards
860	29 38	34	31	28	24	21	18	14	11	07
70	04	01	97	94	91	87	84	81	78	74
80	28 71	68	65	61	58	55	52	48	45	42
90	39	36	32	29	26	23	20	17	13	10
900	07	04	01	98	95	92	89	86	82	79
10	27 76	73	70	67	64	61	58	55	52	49
20	46	43	40	37	34	31	28	25	23	20
30	17	14	11	08	05	02	99	96	93	91
40	26 88	85	82	79	76	74	71	68	65	62
50	59	57	54	51	48	46	43	40	37	34
60	32	29	26	24	21	18	15	13	10	07
70	05	02	99	97	94	91	89	86	83	81
80	25 78	75	73	70	68	65	62	60	57	55
90	52	49	47	44	42	39	37	34	32	29
1000	26	24	21	19	16	14	11	09	06	04
10	01	99	96	94	92	89	87	84	82	79
20	24 77	74	72	70	67	65	62	60	58	55
30	53	51	48	46	43	41	39	36	34	32
40	29	27	25	22	20	18	15	13	11	09
50	06	04	02	99	97	95	93	90	88	86
60	23 83	81	79	77	75	72	70	68	66	63
70	61	59	57	55	52	50	48	46	44	41
80	39	37	35	33	31	29	26	24	22	20
90	18	16	14	12	09	07	05	03	01	99
1100	22 97	95	93	91	89	86	84	82	80	78
10	76	74	72	70	68	66	64	62	60	58
20	56	54	52	50	48	46	44	42	40	38
30	36	34	32	30	28	26	24	22	20	18
40	16	14	12	10	08	07	05	03	01	99
50	21 97	95	93	91	89	87	86	84	82	80
60	78	76	74	72	71	69	67	65	63	61
70	59	58	56	54	52	50	48	47	45	43
80	41	39	37	36	34	32	30	28	27	25
90	23	21	20	18	16	14	12	11	09	07
1200	21 05	04	02	00	98	97	95	93	91	90
10	20 88	86	85	83	81	79	78	76	74	73
20	71	69	68	66	64	62	61	59	57	56
30	54	52	51	49	47	46	44	42	41	39
40	37	36	34	33	31	29	28	26	24	23
50	21	20	18	16	15	13	12	10	08	07
60	05	04	02	00	99	97	96	94	92	91
70	19 89	88	86	85	83	82	80	78	77	75
80	74	72	71	69	68	66	65	63	62	60
90	58	57	55	54	52	51	49	48	46	45

Range	Angle	1	2	3	4	5	6	7	8	9 yards
1300	19 43	42	40	39	37	36	35	33	32	30
10	29	27	26	24	23	21	20	18	17	15
20	14	13	11	10	08	07	05	04	02	01
30	00	98	97	95	94	92	91	90	88	87
40	18 85	84	83	81	80	78	77	76	74	73
50	71	70	69	67	66	65	63	62	60	59
60	58	56	55	54	52	51	50	48	47	45
70	44	43	41	40	39	37	36	35	33	32
80	31	29	28	27	26	24	23	22	20	19
90	18	16	15	14	12	11	10	08	07	06
1400	05	03	02	01	99	98	97	96	94	93
10	17 92	90	89	88	87	85	84	83	82	80
20	79	78	77	75	74	73	72	71	69	68
30	67	66	64	63	62	61	59	58	57	56
40	54	53	52	51	50	48	47	46	45	44
50	42	41	40	39	38	36	35	34	33	32
60	30	29	28	27	26	25	23	22	21	20
70	19	18	16	15	14	13	12	11	09	08
80	07	06	05	04	02	01	00	99	98	97
90	16 96	95	94	92	91	90	89	88	87	85
1500	84	83	82	81	80	79	78	76	75	74
10	73	72	71	70	69	68	66	65	64	63
20	62	61	60	59	58	57	56	55	53	52
30	51	50	49	48	47	46	45	44	43	42
40	41	40	38	37	36	35	34	33	32	31
50	30	29	28	27	26	25	24	23	22	21
60	19	18	17	16	15	14	13	12	11	10
70	09	08	07	06	05	04	03	02	01	00
80	15 99	98	97	96	95	94	93	92	91	90
90	89	88	87	86	85	84	83	82	81	80
1600	79	78	77	76	75	74	73	72	71	70
10	69	68	67	66	65	64	63	62	62	61
20	60	59	58	57	56	55	54	53	52	51
30	50	49	48	47	46	45	44	42	42	41
40	50	40	39	38	37	36	35	34	33	32
50	31	30	29	28	28	27	26	25	24	23
60	22	21	20	19	18	17	17	16	15	14
70	13	12	11	10	09	08	07	07	06	05
80	04	03	02	01	00	99	99	98	97	96
90	14 95	94	93	92	91	91	90	89	88	87
1700	86	85	84	84	83	82	81	80	79	78
10	77	77	76	75	74	73	72	71	71	70
20	69	68	67	66	65	65	64	63	62	61
30	60	60	59	58	57	56	55	55	54	53
40	52	51	50	50	49	48	47	46	45	45

Range	Angle	1	2	3	4	5	6	7	8	9 yards
1750	14 44	43	42	41	40	40	39	38	37	36
60	35	35	34	33	32	31	31	30	29	28
70	27	27	26	25	24	23	22	21	20	
80	19	19	18	17	16	15	15	14	13	12
90	11	11	10	09	08	07	07	06	05	04
1800	04	03	02	01	00	00	99	98	97	97
10	13 96	95	94	94	93	92	91	90	90	89
20	88	87	87	86	85	84	84	83	82	81
30	81	80	79	78	78	77	76	75	75	74
40	73	72	72	71	70	69	69	68	67	66
50	66	65	64	63	63	62	61	61	60	59
60	58	58	57	56	55	55	54	53	52	52
70	51	50	50	49	48	47	47	46	45	45
80	44	43	42	42	41	40	40	39	38	38
90	37	36	36	35	34	33	33	32	31	30
1900	30	29	28	28	27	26	26	25	24	23
10	23	22	21	21	20	19	19	18	17	17
20	16	15	15	14	13	12	12	11	10	10
30	09	08	08	07	06	06	05	04	04	03
40	02	02	01	00	00	99	98	98	97	96
50	12 96	95	94	94	93	92	92	91	90	90
60	89	88	88	87	86	85	84	84	83	83
70	81	80	81	80	79	79	78	77	77	77
80	76	75	75	74	73	73	72	71	70	70
90	70	69	68	68	67	66	66	65	65	64
2000	63	63	62	61	61	60	60	59	58	58
10	57	56	56	55	55	54	53	53	52	51
20	51	50	50	49	48	48	47	46	46	45
30	45	44	43	43	42	42	41	40	40	39
40	38	38	37	37	36	35	35	34	34	33
50	32	32	31	31	30	29	29	28	28	27
60	26	26	25	25	24	23	23	22	22	21
70	20	20	19	19	18	18	17	16	16	15
80	15	14	13	13	12	12	11	11	10	09
90	09	08	08	07	07	06	05	05	04	04
2100	03	03	02	01	01	00	00	99	99	98
10	11 97	97	96	96	95	95	94	93	93	92
20	92	91	91	90	89	89	88	88	87	87
30	86	86	85	84	84	83	83	82	82	81
40	81	80	79	79	78	78	77	77	76	76
50	75	75	74	73	73	72	72	71	71	70
60	70	69	69	68	68	67	66	66	65	65
70	64	64	63	63	62	62	61	61	60	59
80	59	58	58	57	57	56	56	55	55	54
90	54	53	53	52	52	51	50	50	49	49

Range	Angle	1	2	3	4	5	6	7	8	9 yards
2200	11 48	48	47	47	46	46	45	45	44	44
10	43	43	42	42	41	41	40	40	39	39
20	38	37	37	36	36	35	35	34	34	33
30	30	32	32	31	31	30	30	29	29	28
40	28	27	27	26	26	25	25	24	24	23
50	23	22	22	21	21	20	20	19	19	18
60	18	17	17	16	16	15	15	14	14	13
70	13	13	12	12	11	11	10	10	09	09
80	08	08	07	07	06	06	06	05	04	04
90	03	03	02	02	01	01	00	00	99	99
2300	10 98	98	98	97	97	96	96	95	95	94
10	94	93	93	92	92	91	91	90	90	89
20	89	89	88	88	87	87	86	86	85	85
30	84	84	83	83	82	82	81	81	81	80
40	80	79	79	78	78	77	77	76	76	75
50	75	75	74	74	73	73	72	72	70	71
60	70	70	70	69	69	68	68	67	67	66
70	66	66	65	65	64	64	63	63	62	62
80	61	61	61	60	60	59	59	58	58	58
90	57	57	56	56	55	55	54	54	54	53
2400	53	52	52	51	51	50	50	50	49	49
10	48	48	47	47	46	46	46	45	45	44
20	44	44	43	43	42	42	41	41	41	40
30	40	39	39	38	38	38	37	37	36	36
40	35	35	35	34	34	33	33	32	32	32
50	31	31	30	30	30	29	29	28	28	27
60	27	27	26	26	25	25	25	24	24	23
70	23	22	22	22	21	21	20	20	20	19
80	19	18	18	17	17	16	16	16	15	15
90	15	14	14	13	13	13	12	12	11	11
2500	11	10	10	09	09	09	08	08	07	07
10	07	06	06	05	05	05	04	04	03	03
20	03	02	02	01	01	01	00	00	99	99
30	9 99	98	98	97	97	97	96	96	95	95
40	95	94	94	94	93	93	92	92	92	91
50	91	90	90	90	89	89	88	88	88	87
60	97	97	86	86	85	85	85	84	84	83
70	83	83	82	82	82	81	81	80	80	80
80	79	79	78	78	78	77	77	77	76	76
90	75	75	75	74	74	74	73	73	72	72
2600	72	71	71	71	70	70	69	69	69	68
10	68	68	67	67	67	66	66	65	65	65
20	64	64	64	63	63	62	62	62	61	61
30	61	60	60	60	59	59	58	58	58	57
40	57	57	56	56	56	55	55	54	54	54

Range	Angle	1	2	3	4	5	6	7	8	9 yards
2650	9 53	53	53	52	52	52	51	51	51	50
60	50	49	49	49	48	48	48	47	47	47
70	46	46	46	45	45	44	44	44	43	43
80	43	42	42	42	41	41	41	40	40	40
90	39	39	39	38	38	37	37	37	36	36
2700	36	35	35	35	34	34	34	33	33	33
10	32	32	32	31	31	31	30	30	30	29
20	29	29	28	28	27	27	27	26	26	26
30	25	25	25	24	24	24	23	23	23	22
40	22	22	21	21	21	20	20	20	19	19
50	19	18	18	18	17	17	17	16	16	16
60	15	15	15	14	14	14	13	13	13	12
70	12	12	11	11	11	10	10	10	09	09
80	09	08	08	08	07	07	07	07	06	06
90	06	05	05	05	04	04	04	03	03	03
2800	02	02	02	01	01	01	00	00	00	99
10	8 99	99	99	98	98	98	97	97	97	96
20	96	96	95	95	95	94	94	94	93	93
30	93	92	92	92	91	91	91	91	90	90
40	90	89	89	89	88	88	88	87	87	87
50	86	86	86	86	85	85	85	84	84	84
60	83	83	83	82	82	82	81	81	81	81
70	80	80	80	79	79	79	78	78	78	78
80	77	77	77	76	76	76	75	75	75	75
90	74	74	74	73	73	73	72	72	72	72
2900	71	71	71	70	70	70	69	69	69	69
10	68	68	68	67	67	67	66	66	66	66
20	65	65	65	64	64	64	63	63	63	63
30	62	62	62	61	61	61	60	60	60	60
40	59	59	59	58	58	58	57	57	57	57
50	56	56	56	56	55	55	55	54	54	54
60	54	53	53	53	52	52	52	51	51	51
70	51	50	50	50	49	49	49	48	48	48
80	48	48	47	47	47	46	46	46	46	45
90	45	45	44	44	44	44	43	43	43	42
3000	42	42	42	41	41	41	40	40	40	40
10	39	39	39	39	38	38	38	37	37	37
20	37	36	36	36	35	35	35	35	34	34
30	34	34	33	33	33	32	32	32	32	31
40	31	31	31	30	30	30	29	29	29	29
50	28	28	28	28	27	27	27	26	26	26
60	26	25	25	25	25	24	24	24	23	23
70	23	23	22	22	22	22	21	21	21	21
80	20	20	20	19	19	19	19	18	18	18
90	18	17	17	17	17	16	16	16	16	15

Range	Angle	1	2	3	4	5	6	7	8	9 yards
3100	8 15	15	14	14	14	14	13	13	13	13
10	12	12	12	12	11	11	11	11	10	10
20	10	10	09	09	09	08	08	08	08	07
30	07	07	07	06	06	06	06	05	05	05
0	05	04	04	04	04	03	03	03	03	02
0	02	02	02	01	01	01	01	00	00	00
60	00	99	99	99	99	98	98	98	98	97
70	7 97	97	96	96	96	96	95	95	95	95
80	94	94	94	94	93	93	93	93	92	92
90	92	92	92	91	91	91	91	90	90	90

3200 9


APPENDIX IX

THE MARK VI INSTRUMENT (see Plate IX)

The following alterations and improvements will be found in the Mark VI Instrument :—

1. The web sling is attached to bars fitted flush with the end caps.
2. The coincidence adjusting head and the halving adjusting head are mounted on the left tube end, and each is protected by a circular sliding shutter. (See Fig. 16.)
3. The coincidence adjusting scale (C.A.S.) is on the lower rim of the left window, and is revolved by the coincidence adjusting head, while the pointer remains steady.
4. The rubber facepiece is of thick sorbo-rubber.
5. The eyepieces have no cover on segment to protect them.
6. The moderating glasses (grey, yellow and green) are operated by a lever placed in front of and below the right eyepiece.
7. The range scale window has no hinged cover.
8. The range scale as viewed through the left eyepiece is read from top to bottom, and not reversed as in other models. The infinity scale is therefore minus above the asterisk and plus below.

PLATE IX

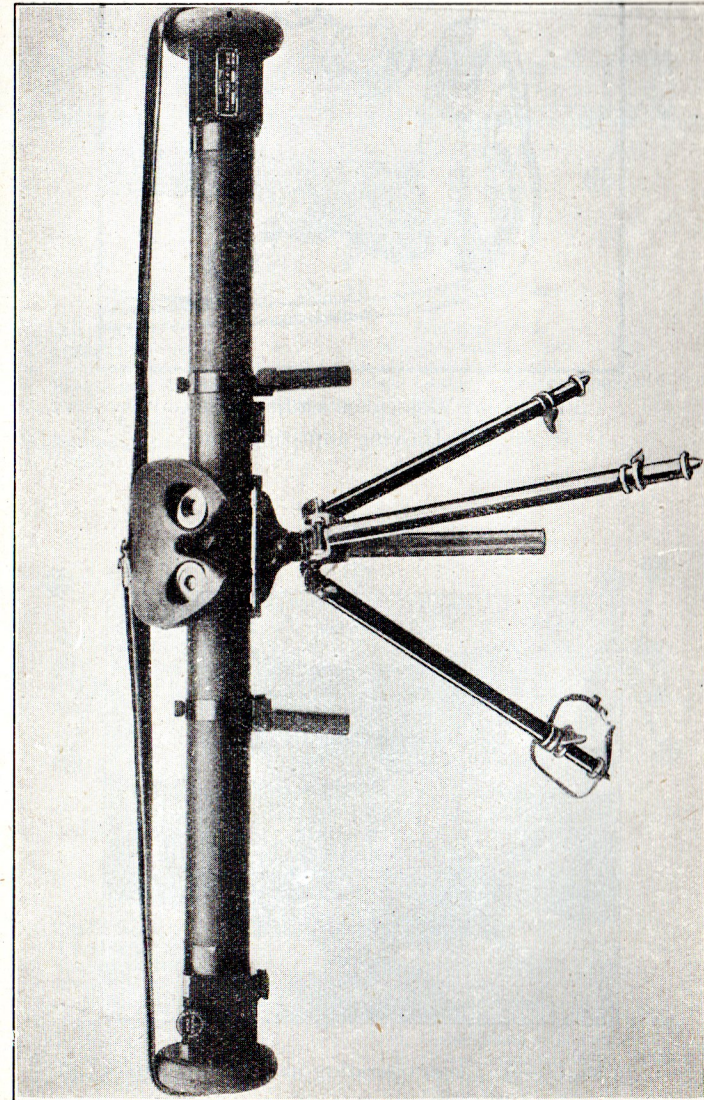

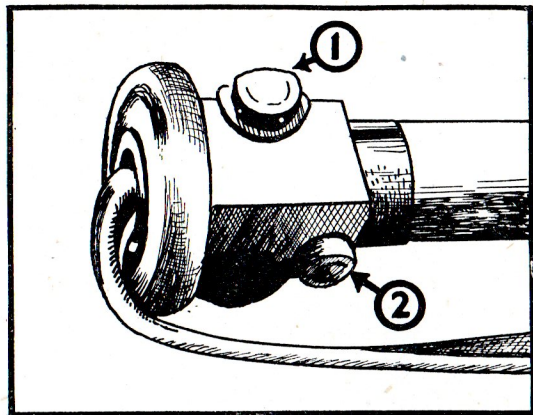


FIG. 16.—1. Coincidence adjusting head
2. Halving adjusting head.


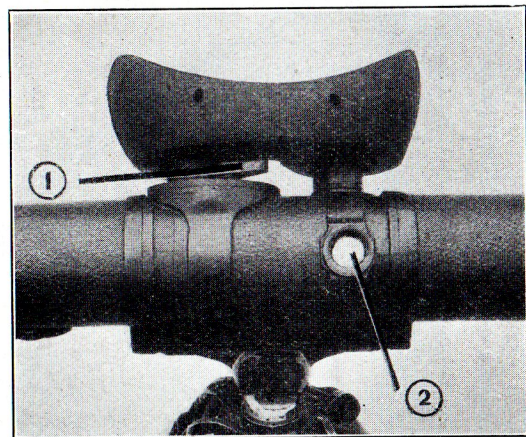


FIG. 17.—1. Lever operating moderating glasses.
2. Range scale window.


PLATE I

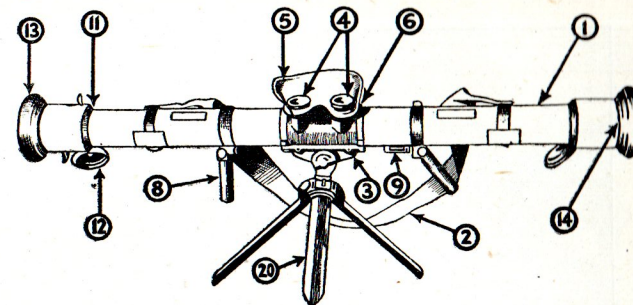

Range-finder No. 12. View from rear.

- | | |
|----------------------------------------------|------------------------------|
| 1. Outer tube. | 9. Working head. |
| 2. Detachable web sling. | 10. Astigmatizer lever. |
| 3. Carrier plate. | 11. Tube ends. |
| 4. Eyepieces left and right. | 12. Leather protecting caps. |
| 5. Detachable rubber facepiece No. 1, Mk. I. | 13. End cap. |
| 6. Focusing lever. | 14. Locking pieces. |
| 8. Handles. | 20. Stand No. 14, Mk. II. |


PLATE II

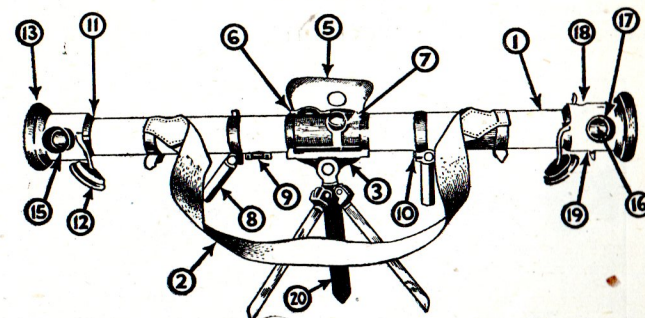

Range-finder No. 12. View from front.

- | | |
|----------------------------------------------|----------------------------------|
| 1. Outer tube. | 10. Astigmatizer lever. |
| 2. Detachable web sling. | 11. Tube ends. |
| 3. Carrier plate. | 12. Leather protecting cap. |
| 5. Detachable rubber facepiece No. 1, Mk. I. | 13. End cap. |
| 7. Front range scale window No. 2, Mk. I. | 15. Right window. |
| 8. Handles. | 16. Coincidence adjusting prism. |
| 9. Working head. | 17. Coincidence scale ring. |
| | 18. Coincidence adjusting head. |
| | 19. Halving adjusting head. |
| | 20. Stand No. 14, Mk. II. |


PLATE IA

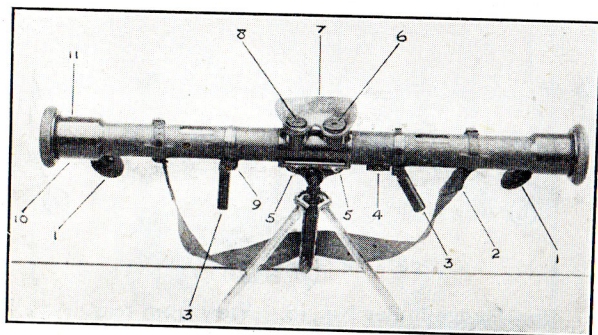

Range-finder No. 12. View from rear.

- | | |
|----------------------------|---------------------------------|
| 1. Window caps. | 6. Right eyepiece. |
| 2. Sling. | 7. Rubber facepiece. |
| 3. Right and left handles. | 8. Left eyepiece. |
| 4. Working head. | 9. Astigmatizer lever. |
| 5. Carrier. | 10. Halving adjusting head. |
| | 11. Coincidence adjusting head. |


PLATE IIA

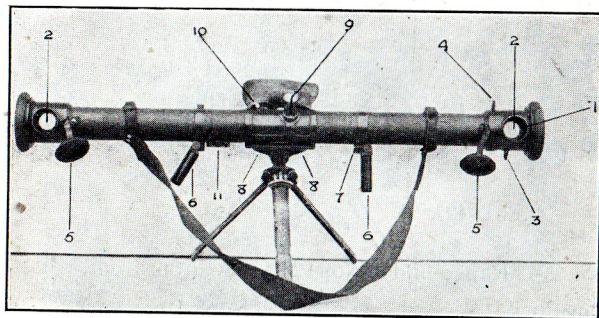

Range-finder No. 12. View from front.

- | | |
|-------------------------------------|-----------------------------------------------|
| 1. Coincidence adjusting scale. | 7. Astigmatizer lever. |
| 2. Left and right windows. | 8. Carrier. |
| 3. Halving adjusting head flap. | 9. Front range scale window cover and window. |
| 4. Coincidence adjusting head flap. | 10. Focusing lever. |
| 5. Window caps. | 11. Working head. |
| 6. Left and right handles. | |

PLATE III

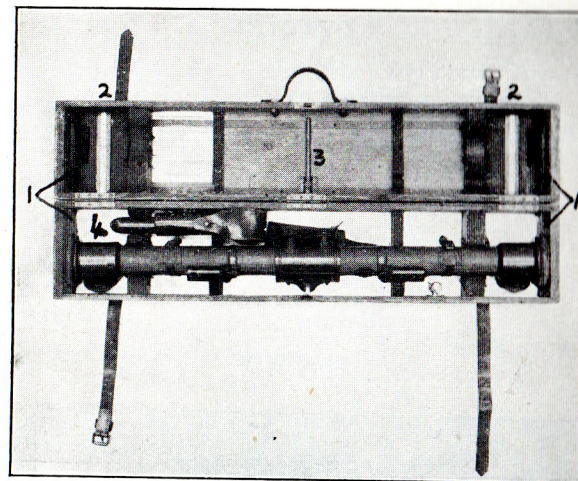


Range-finder No. 12 in wooden case.

- | | |
|---------------------|---------------------------|
| 1. Felt pads. | 3. Supporting rod. |
| 2. Laths adjusting. | 4. Stand in leather frog. |

Note.—When the stand No. 14, Mark III, is used, it is not carried in the case but in the canvas cover (see Plate V).


PLATE IV

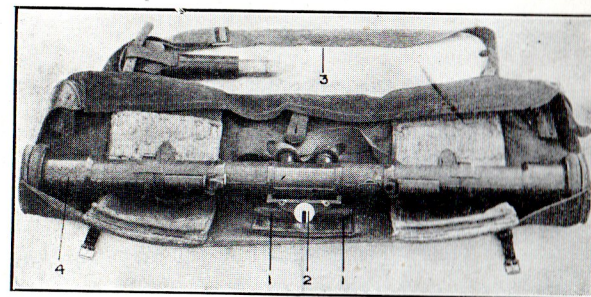

Range-finder No. 12 placed in canvas cover ready for packing.

- | | |
|--------------------------|---------------------------------|
| 1. Leather pad on cover. | 3. Web sling. |
| 2. Carrier. | 4. Halving adjusting head flap. |

PLATE V

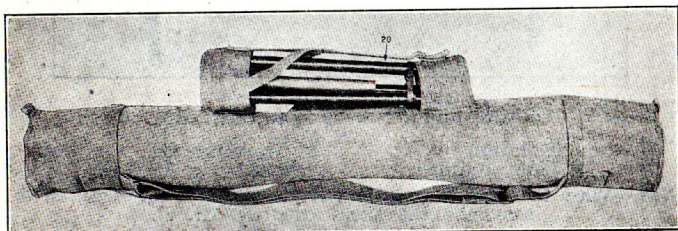

Range-finder No. 12 packed in canvas cover.

20. Stand No. 14, Mark III.

Contents—continued from page ii of cover

SECTION	PAGE
12. Range cards.	
Lesson 11. Construction of range cards ...	32
13. Taking ranges under difficult conditions.	
Lesson 12. Difficult objects ...	33
Lesson 13. Taking ranges in rain and shimmer ...	34
Lesson 14. Taking ranges to moving objects ...	34
14. Concealment and field duties.	
Lesson 15. Positions and concealment ...	36
Lesson 16. Field duties ...	36
15. Range-takers' tests.	
General ...	39
Test of elementary training ...	40
Conduct of annual test ...	40
Annual test practice ...	42

APPENDICES

I. Syllabus of training ...	43
II. Instrument tests ...	45
III. Examination and test of range-finders ...	46
IV. Determination of known ranges ...	49
V. Values of r^2 ...	52
VI. Apparatus, training range-takers ...	54
VII. Annual test ...	55
VIII. Falsification Tables ...	58
IX. The Mark VI instrument ...	66





This manual has been scanned by the
Vickers MG Collection & Research Association

www.vickersmg.org.uk

Please support the work of the Association.

Click on the image to donate through
PayPal:



Or regularly support us through
Patreon:



Or make a quick, single donation:



A not-for-profit company, limited by guarantee, registered in England, Company Registration Number 07855202